



AD-A105 933 BAKER (MICHAEL) JR INC BEAVER PA
NATIONAL DAM SAFETY PROGRAM. WILLOW BROOK DAM (INVENTORY NUMBER--ETC(U)
AUG 81 G KESTER F/G 13/13
DACP51-81-C-0010
NL

UNCLASSIFIED

1 OF 2
ADA
105933

E

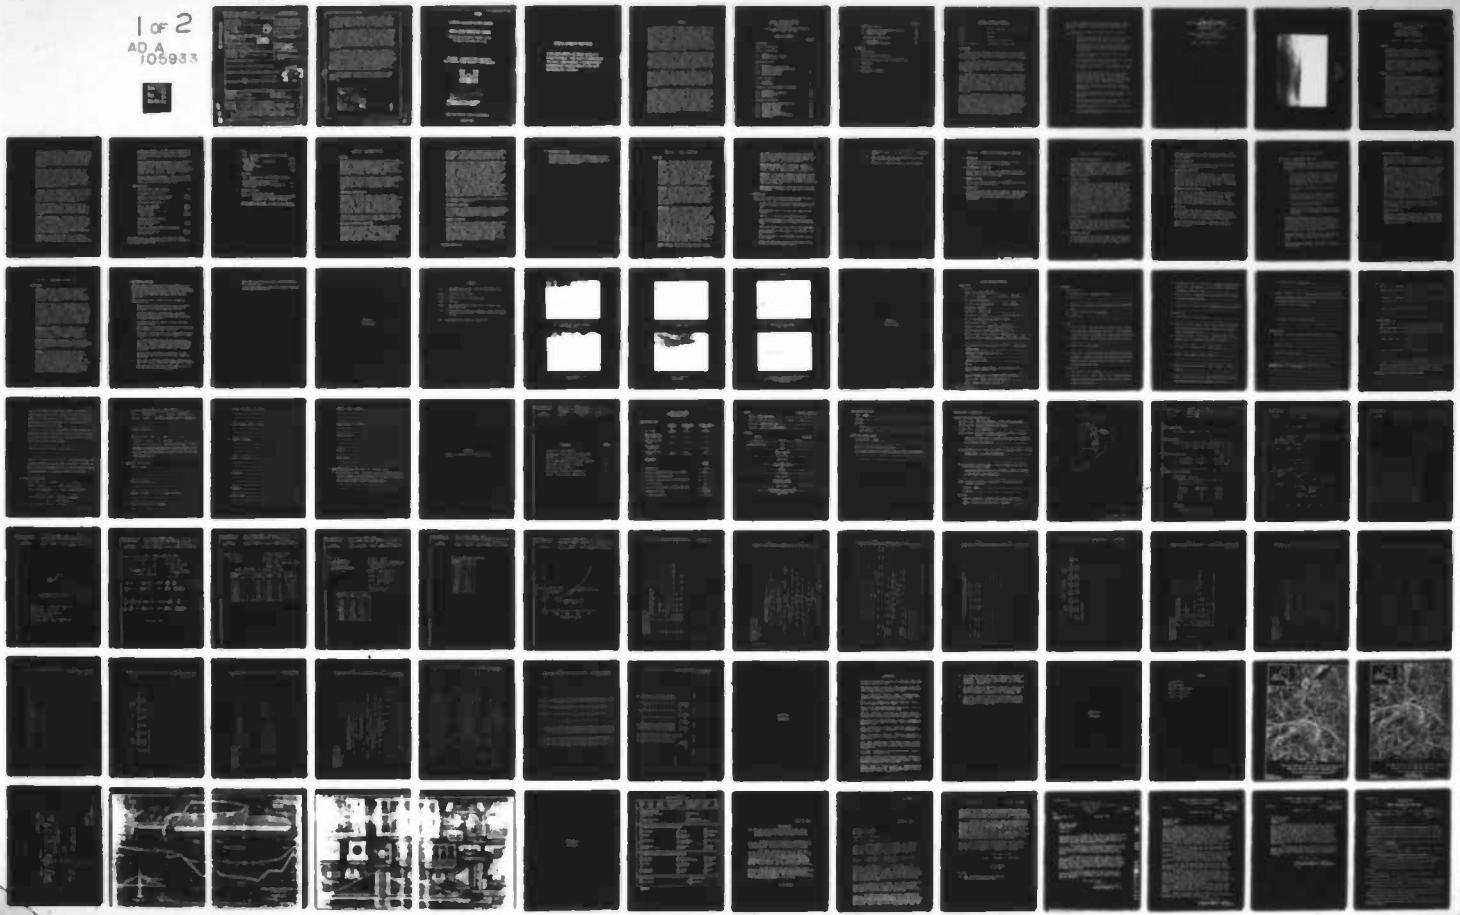

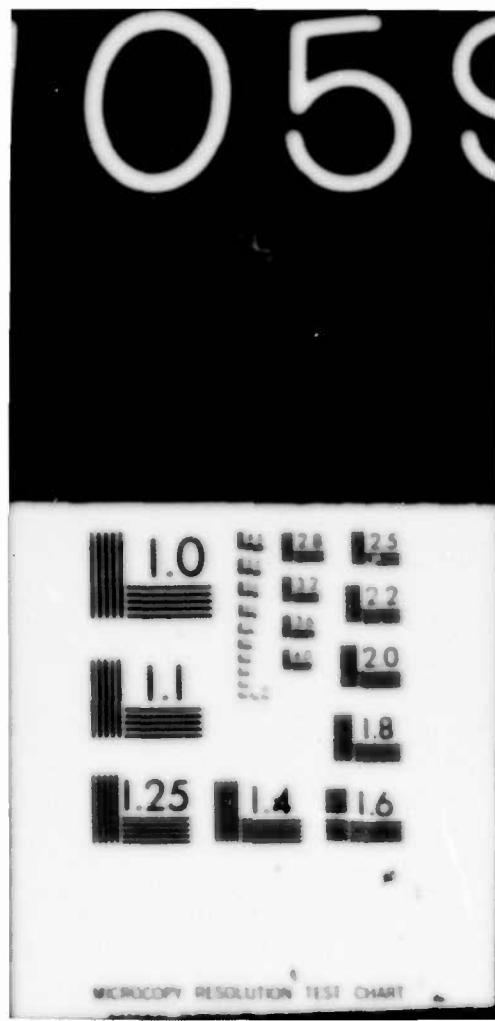

ADA105933

National Dam Safety Program. Willow Brook Dam (Inventory Number NY 35). Lower Hudson River Basin, Orange County, New York. Phase I Inspection Report.

TITLE
Phase I Inspection Report
Willow Brook Dam
Lower Hudson River Basin, Orange County, NY
Inventory No. 35

7. AUTHORIZE
GRANVILLE KESTER, JR.

8. PERFORMING ORGANIZATION NAME AND ADDRESS
Michael Baker, Jr. Inc.
4301 Dutch Ridge Road
Box 280
Reaver, PA 15009

9. CONTROLLING OFFICE NAME AND ADDRESS
Department of the Army
26 Federal Plaza New York District, CofE
New York, New York 10287

10. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)
Department of the Army
26 Federal Plaza New York District, CofE
New York, NY 10287

11. DISTRIBUTION STATEMENT (of this Report)

Approved for public release; Distribution unlimited.

12. APPROVAL DATE
14 August 1981

13. NUMBER OF PAGES
102

14. SECURITY CLASS. (If data reported)

UNCLASSIFIED

15. DECLASSIFICATION/DOWNGRADING SCHEDULE

16. DISTRIBUTION STATEMENT (if the abstract entered in Block 20, is different from Report)

THIS DOCUMENT IS BEST QUALITY PRACTICABLE.
WE DON'T WANT YOU TO DO ANYTHING WHICH WILL HARM YOU.

17. SUPPLEMENTARY NOTES
APPENDIXES ARE NOT INCLUDED.

18. KEY WORDS (Continue on reverse side if necessary and identify by block number)

Dam Safety
National Dam Safety Program
Visual Inspection
Hydrology, Structural Stability

Willow Brook Dam
Orange County
Lower Hudson River Basin

19. ABSTRACT (Continue on reverse side if necessary and identify by block number)

This report provides information and analysis on the physical condition of the dam as of the report date. Information and analysis are based on visual inspection of the dam by the performing organization.

Examination of available documents and a visual inspection of the dam and appurtenant structures did not reveal any conditions which constitute an immediate hazard to human life or property.

DD FORM 1 JAN 73 EDITION OF 1 NOV 63 IS OBSOLETE

SECURITY CLASSIFICATION OF THIS PAGE IS UNCHANGED

10 10 19470715

FILE COPY

Using the Corps of Engineers' screening criteria, it has been determined that the dam would be overtopped for all storms exceeding approximately 28 percent of the Probable Maximum Flood (PMF). The spillway is, therefore, adjudged as "seriously inadequate" and the dam is assessed as unsafe, non-emergency.

The classification of "unsafe" applied to a dam because of a "seriously inadequate spillway" is not meant to connote the same degree of emergency as would be associated with an "unsafe" classification applied for a structural deficiency. It does mean, however, that, based on an initial screening and preliminary computations, there appears to be a serious deficiency in spillway capacity, so that if a severe storm were to occur, overtopping and failure of the dam would take place, significantly increasing the hazard to loss of life downstream.

It is therefore recommended that, within 3 months of notification of the owner, detailed hydrologic and hydraulic investigations of the structure should be undertaken to more accurately determine the site-specific characteristics of the watershed and their effects upon the overtopping potential of the dam. The results of these investigations and analyses will determine the appropriate remedial measures which will be required. In the interim, a detailed emergency action plan must be developed and implemented during periods of unusually heavy precipitation. Also, around-the-clock surveillance must be provided during these periods.

Current inspection and maintenance procedures by the owner are inadequate. Monitoring of the reservoir levels should be expanded to include readings during peak flow periods.



MURKIN

LOWER HUDSON RIVER BASIN

WILLOW BROOK DAM

**ORANGE COUNTY, NEW YORK
INVENTORY NO. N.Y. 35**

**PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM**



THIS DOCUMENT CONTAINS neither recommendations nor conclusions of the U.S. Army Corps of Engineers. It is the property of the Corps and is loaned to your agency; it and its contents are not to be distributed outside your agency without the express written authority of the Director, Office of Water Resources Research, U.S. Army Corps of Engineers. A significant number of pages which do not reproduce legibly.

**APPROVED FOR PUBLIC RELEASE;
DISTRIBUTION UNLIMITED**

NEW YORK DISTRICT CORPS OF ENGINEERS

AUGUST 1981

DISCLAIMER NOTICE

**THIS DOCUMENT IS BEST QUALITY
PRACTICABLE. THE COPY FURNISHED
TO DTIC CONTAINED A SIGNIFICANT
NUMBER OF PAGES WHICH DO NOT
REPRODUCE LEGIBLY.**

PREFACE

This report is prepared under guidance contained in the Recommended Guidelines for Safety Inspection of Dams, for Phase I Investigations. Copies of these guidelines may be obtained from the Office of Chief of Engineers, Washington, D.C. 20314. The purpose of a Phase I Investigation is to identify expeditiously those dams which may pose hazards to human life or property. The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigation and analyses involving topographic mapping, subsurface investigations, testing, and detailed computational evaluations are beyond the scope of a Phase I Investigation; however, the investigation is intended to identify any need for such studies.

In reviewing this report, it should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team. In cases where the reservoir was lowered or drained prior to inspection, such action, while improving the stability and safety of the dam, removes the normal load on the structure and may obscure certain conditions which might otherwise be detectable if inspected under the normal operating environment of the structure.

It is important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through frequent inspections can unsafe conditions be detected and only through continued care and maintenance can these conditions be prevented or corrected.

Phase I inspections are not intended to provide detailed hydrologic and hydraulic analyses. In accordance with the established Guidelines, the Spillway Test flood is based on the estimated "Probable Maximum Flood" for the region (greatest reasonably possible storm runoff), or fractions thereof. Because of the magnitude and rarity of such a storm event, a finding that a spillway will not pass the test flood should not be interpreted as necessarily posing a highly inadequate condition. The test flood provides a measure of relative spillway capacity and serves as an aide in determining the need for more detailed hydrologic and hydraulic studies, considering the size of the dam, its general condition and the downstream damage potential.

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM
WILLOW BROOK DAM
I.D. No. NY 35
DEC DAM No. 195C-450 LOWER HUDSON RIVER BASIN
ORANGE COUNTY, NEW YORK

TABLE OF CONTENTS

	<u>PAGE NO.</u>
- ASSESSMENT	-
- OVERVIEW PHOTOGRAPH	-
1 PROJECT INFORMATION	1
1.1 GENERAL	1
1.2 DESCRIPTION OF PROJECT	1
1.3 PERTINENT DATA	3
2 ENGINEERING DATA	5
2.1 GEOLOGY	5
2.2 SUBSURFACE INVESTIGATION	5
2.3 DAM AND APPURTENANT STRUCTURES	5
2.4 CONSTRUCTION RECORDS	6
2.5 OPERATION RECORDS	6
2.6 EVALUATION OF DATA	7
3 VISUAL INSPECTION	9
3.1 FINDINGS	9
3.2 EVALUATION	10
4 OPERATION AND MAINTENANCE PROCEDURES	13
4.1 PROCEDURES	13
4.2 MAINTENANCE OF THE DAM	13
4.3 WARNING SYSTEM	13
4.4 EVALUATION	13
5 HYDRAULIC/HYDROLOGIC	15
5.1 DRAINAGE AREA CHARACTERISTICS	15
5.2 ANALYSIS CRITERIA	15
5.3 SPILLWAY CAPACITY	15
5.4 RESERVOIR CAPACITY	15
5.5 FLOODS OF RECORD	16
5.6 OVERTOPPING POTENTIAL	16
5.7 RESERVOIR EMPTYING POTENTIAL	16
5.8 EVALUATION	16

	<u>PAGE NO.</u>
6 STRUCTURAL STABILITY	17
6.1 EVALUATION OF EMBANKMENT STABILITY	17
6.2 STABILITY ANALYSIS	18
6.3 SEISMIC STABILITY	18
7 ASSESSMENT/RECOMMENDATIONS	19
7.1 ASSESSMENT	19
7.2 RECOMMENDED MEASURES	21

APPENDIX

- A. PHOTOGRAHPS
- B. VISUAL INSPECTION CHECKLIST
- C. HYDROLOGIC/HYDRAULIC DATA AND COMPUTATIONS
- D. REFERENCES
- E. DRAWINGS
- F. BACKGROUND DOCUMENTS

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM

Name of Dam: Willow Brook Dam (I.D. No. NY 35)
State: New York
County: Orange
Stream: Tributary of Moodna Creek
Dates of Inspection: 5 March 1981, 9 March 1981

ASSESSMENT

Examination of available documents and a visual inspection of the dam and appurtenant structures did not reveal any conditions which constitute an immediate hazard to human life or property.

Using the Corps of Engineers' screening criteria, it has been determined that the dam would be overtopped for all storms exceeding approximately 28 percent of the Probable Maximum Flood (PMF). The spillway is, therefore, adjudged as "seriously inadequate" and the dam is assessed as unsafe, non-emergency.

The classification of "unsafe" applied to a dam because of a "seriously inadequate spillway" is not meant to connote the same degree of emergency as would be associated with an "unsafe" classification applied for a structural deficiency. It does mean, however, that, based on an initial screening and preliminary computations, there appears to be a serious deficiency in spillway capacity, so that if a severe storm were to occur, overtopping and failure of the dam would take place, significantly increasing the hazard to loss of life downstream.

It is therefore recommended that, within 3 months of notification of the owner, detailed hydrologic and hydraulic investigations of the structure should be undertaken to more accurately determine the site-specific characteristics of the watershed and their effects upon the overtopping potential of the dam. The results of these investigations and analyses will determine the appropriate remedial measures which will be required. In the interim, a detailed emergency action plan must be developed and implemented during periods of unusually heavy precipitation. Also, around-the-clock surveillance must be provided during these periods.

Current inspection and maintenance procedures by the owner are inadequate. Monitoring of the reservoir levels should be expanded to include readings during peak flow periods.

The following remedial measures must be completed within one year:

1. The low area of the dam crest on the left side of the spillway should be filled to the average elevation of the top of dam, 590.0 ft. M.S.L.
2. The deterioration in the spillway wingwalls should be repaired and rock riprap should be placed at the junction of the wingwalls and dam to prevent undercutting.
3. All debris should be removed from the spillway discharge channel.
4. The riprap on the upstream face should be redressed and extended to the crest of the dam.
5. The crest of the dam should be regraded and leveled to elevation 590.0 M.S.L. with a width of at least 5 feet.
6. All brush and trees should be cut off at ground level over the entire dam, and the embankment should be mowed regularly. The root systems should be removed for trees with a trunk diameter greater than 3 inches, and the resultant cavities should be backfilled, compacted, and seeded.
7. The uprooted trees should be removed, and the depressions left should be backfilled, compacted, and seeded.
8. The cracks in the spillway discharge channel walls should be repaired, and joints repointed as necessary.
9. The missing concrete caps for the masonry walls at the spillway weir should be replaced.
10. The cracks in the concrete top of the springhouse should be repaired.
11. A staff gage should be installed to monitor reservoir levels above normal pool.

SUBMITTED:

Granville Kester Jr.
Granville Kester, Jr., P.E.
Vice President
MICHAEL BAKER JR. of New York, INC.

APPROVED:

Colonel W.M. Smith Jr.
Colonel W.M. Smith, Jr.
New York District Engineer

DATE: 14 Aug 81



Overall View of Dam
Willow Brook Dam
I.D. No. NY 35
9 March 1981

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM
WILLOW BROOK DAM
I.D. No. NY 35
DEC DAM No. 195C-450
LOWER HUDSON RIVER BASIN
ORANGE COUNTY, NEW YORK

SECTION 1: PROJECT INFORMATION

1.1 GENERAL

- a. Authority - The Phase I Inspection reported herein was authorized by the Department of the Army, New York District, Corps of Engineers, to fulfill the requirements of the National Dam Inspection Act, Public Law 92-367.
- b. Purpose of Inspection - This inspection was conducted to evaluate the existing conditions of the dam, to identify deficiencies and hazardous conditions, to determine if these deficiencies constitute hazards to life and property, and to recommend remedial measures where required.

1.2 DESCRIPTION OF PROJECT

- a. Description of Dam and Appurtenances - Willow Brook Dam is an earthfill embankment with a concrete core wall. The dam is 540 feet long and 18.5 feet high, measured from the invert of the outlet pipe, at the downstream toe to the minimum top of dam. The crest width of the dam varies from 3 feet to 4.5 feet. A concrete springhouse is located on the right side of the upstream face of the embankment, and a concrete gate house is situated at the center of the embankment. There is no internal drainage system for the dam.

A concrete spillway is located on the left¹ side of the dam. The spillway consists of a concrete, broad-crested weir and concrete training walls faced with stone. The broad-crested weir, with a length of 25 feet and breadth of 5 feet, has an inclined upstream face of about 45 degrees, and a vertical downstream face. Water passing over the weir cascades down two concrete steps, each 1

¹Looking downstream.

foot wide by 2 feet high, to a paved masonry apron with masonry training walls. Water then passes over a rock rubble falls and through a discharge channel consisting of masonry paved bottom and sides. The masonry walls of the spillway and discharge channel are capped with concrete. The discharge channel empties into a corrugated steel culvert, 5.5 feet wide by 3.0 feet high, under the road downstream of the dam.

The outlet works consist of a 24-inch cast iron pipe placed through the center of the dam. A concrete gate house is located on the upstream side, center of the dam, containing the control for the gate on the outlet pipe. The outlet pipe exits into a channel consisting of masonry paved bottom and sides. The masonry walls are capped with concrete. The outlet works channel joins the spillway discharge channel and empties into the same corrugated steel culvert.

- b. Location - Willow Brook Dam is located in the Town of Blooming Grove, Orange County, New York, on an unnamed tributary of Moodna Creek. The coordinates of the dam are N 41° 20.9' and W 74° 11.8'. The dam and reservoir are located on the U.S.G.S. 7.5 minute topographic quadrangle Monroe, New York. A Location Plan is included in Appendix E.
- c. Size Classification - The height of the dam is 18.5 feet, and the reservoir volume at the top of the dam is 1061 acre-feet. Therefore, the dam is in the "intermediate" size category as defined by the Recommended Guidelines for Safety Inspection of Dams.
- d. Hazard Classification - Three homes are located about 1 mile downstream of the dam. A fourth home and an apartment complex are located 1.4 and 1.5 miles, respectively, downstream of the dam. There is danger of loss of human life from large flows downstream of the dam. Therefore, Willow Brook Dam is considered to be in the "high" hazard category as defined by the Recommended Guidelines for Safety Inspection of Dams.
- e. Ownership - The dam and reservoir are owned by Orange and Rockland Utilities Inc., 71 Dolson Avenue, Middletown, New York 10940. The contact person is Mr. George Begbie (Telephone 914-343-5324).

- f. Purpose of the Dam - The dam was originally built to impound water for cooling steam condensers of the Orange and Rockland Electric Co. The dam and reservoir are presently used for recreational purposes.
- g. Design and Construction History - Willow Brook Dam was designed by Knight, Bush and Thompson Civil Engineers and Surveyors of Monroe, New York in November, 1923. Orange and Rockland Electric Co. constructed the dam in the fall of 1925 and spring, summer, and fall of 1926. The design engineers supervised construction of the dam.
- h. Normal Operating Procedures - There are no formal written operational procedures for Willow Brook Dam. The reservoir is normally maintained at the crest elevation of the spillway weir.

1.3 PERTINENT DATA

a.	<u>Drainage Area (square miles)</u> -	1.34
b.	<u>Discharge at Dam (c.f.s.)</u> -	
	Spillway at Top of Dam (Minimum)	425.0
	Reservoir Drain at Normal Pool	53.0
c.	<u>Elevations (Feet M.S.L.)</u> ² -	
	Top of Dam (Average)	590.0
	Top of Dam (Minimum)	588.2
	Spillway Crest	585.0
	Reservoir Drain (24" C.I.P.)	
	Inlet Invert	570.0
	Outlet Invert	569.66
d.	<u>Reservoir Surface (Acres)</u> -	
	Top of Dam (Minimum)	76.0
	Spillway Crest	63.4
e.	<u>Reservoir Storage Capacity (Acre-Feet)</u> -	
	Top of Dam (Minimum)	1061.0
	Spillway Crest	841.0

²All elevations are referenced to the spillway crest, elevation 585.0 feet Mean Sea Level (M.S.L.), as shown on the original design plans.

f. Dam -

Type:	Earthfill embankment with concrete core wall
Length (Feet)	540.0
Slopes (Vertical : Horizontal)	
Upstream -	1:2.2
Downstream -	1:2.1
Crest Width (Feet)	
Maximum -	4.5
Minimum -	3.0

g. Spillway -

Type:	Uncontrolled, broad-crested concrete weir.
Length of Crest Perpendicular to Direction of Flow (feet)	25.0
Width of Crest Parallel to Direction of Flow (feet)	3.0

h. Reservoir Drain -

Type:	24-inch Cast Iron Pipe
Control:	Control for the gate on the outlet pipe is located in the gate house at the upstream side, center of the dam.

i. Appurtenant Structures - A concrete springhouse is located on the right upstream side of the dam.

SECTION 2: ENGINEERING DATA

2.1 GEOLOGY

Willow Brook Dam is located in a narrow portion of the Appalachian Uplands physiographic province in southeastern New York. The Geologic Map of New York (Reference 2, Appendix D) describes bedrock in the immediate area of the dam as undifferentiated sedimentary deposits of Lower Devonian and Silurian sandstones, shales, limestones and dolostones. These bedrock units are overlain by glacial till deposits of variable depth.

Although references do not show any faulting at the dam site, bedrock in the surrounding area has been extensively disrupted by faulting; normal faults are located from 1 to 3 miles to the south and northwest of the site, respectively, whereas a large northeast-southwest trending thrust fault is located about 2 miles to the east.

2.2 SUBSURFACE INVESTIGATION

The profile of the dam shown on the original plans (Appendix E) provides a general description of foundation conditions at the site, based on boring data. This profile shows that the site was overlain by deposits of clay, hardpan, and boulders, varying in thickness up to about 50 feet. A rock outcrop was reported on the left abutment, near the spillway. Bedrock is described on the profile as gneiss, shale and limestone. As shown on the field sketch in Appendix E, the outcrop shown on the original plans was also noted during the inspection.

A memorandum provided by the owner indicates that there are two limestone "caverns" located under the lake. A copy of the memorandum is included in Appendix F.

2.3 DAM AND APPURTENANT STRUCTURES

Two drawings for the dam prepared by Knight, Bush and Thompson, Civil Engineers and Surveyors, for the Orange and Rockland Electric Co., were available for review during these investigations. The drawings illustrate the original dam design features. These drawings are included in Appendix E. Copies of correspondence between Knight, Bush and Thompson and the State of New York, Department of State Engineer and Surveyor

were also provided for the inspection and are included in Appendix F. The letters discuss design and construction details and a request for a construction permit extension. They were written during construction of the dam. The dam was constructed during 1925 and 1926.

This structure is comprised of an earth embankment with a concrete core wall. The available drawings indicate that the concrete core wall is keyed into bedrock. A concrete spillway is located on the left¹ side of the structure. The spillway discharge channel consists of a masonry paved bottom and sides, and runs from the spillway, along the toe of the embankment, to the center of the dam where it joins the downstream channel. A 24-inch diameter cast iron pipe serves as the outlet for the dam. A slide gate, controlled by hand crank, is used to control flow from the outlet. The outlet and gate house are located near the center of the structure. Near the right end of the embankment is a springhouse. A pipe in the springhouse is connected to one of the two "caverns" previously mentioned. The pipe could be used as a well, but at the present time, it is unused. The other "cavern" was piped to the spring pond located downstream of the dam. A description of the limestone "caverns" is included in Appendix F.

The existing dam is illustrated by a field sketch which is included in Appendix E.

2.4 CONSTRUCTION RECORDS

No information concerning construction of the structure is available other than the previously discussed drawings and letters, and a permit application for dam construction to the New York Department of State Engineer and Surveyor (the application is included in Appendix G).

2.5 OPERATION RECORDS

The slide gate controlling discharges is opened approximately once or twice each year when the lake level rises approximately 12 inches over spillway elevation and floods the old power plant located along the lake shore. Once the lake level drops to spillway level, the gate is closed. The owner has no procedures for regular dam inspections or regular maintenance. The only known maintenance performed at this dam in the last few years was the removal of some brush from the upstream face during the winter of 1979-1980.

¹Looking downstream.

2.6 EVALUATION OF DATA

The background information collected during the investigation was obtained from Mr. George Begbie of the Orange and Rockland Utilities Inc. Available engineering data are considered adequate and reliable for Phase I Inspection purposes.

SECTION 3: VISUAL INSPECTION

3.1 FINDINGS

- a. General - The inspection of Willow Brook Dam was conducted on 5 March 1981 during cool and cloudy weather. Light snow fell during the inspection, and temperatures ranged from 30°F to 33°F. The reservoir level was at the crest of the spillway. A follow up inspection was conducted on 9 March 1981. This inspection was made to observe the embankment without snow and to take additional pictures. Deficiencies found during the inspection will require remedial treatment. A Field Sketch of conditions found during the inspection is included in Appendix F. The complete Visual Inspection Checklist is presented as Appendix B.
- b. Spillway - The upstream ends of the wingwalls are undercut and show signs of deterioration. The concrete caps for the masonry walls at the spillway weir are missing (as shown in Photo 4). In the spillway discharge channel, there are some minor cracks in the masonry walls above normal water level. A few boards were found in the channel at the rock rubble falls, and tree branches were in the channel near the confluence with the outlet works channel.
- c. Embankment - The entire upstream face, crest, and downstream face are covered with brush and trees (as shown in Photos 1 and 2). There are several uprooted trees on the dam, one on the upstream face (shown in Photo 3), and three on the downstream face (see Field Sketch in Appendix E). The width at the crest of the dam varies from 3.0 feet to 4.5 feet. A footpath is worn along the upstream side of the crest. On the left side of the spillway masonry wall, the crest is eroded to the top of the concrete core wall (as shown in Photo 4). The upstream face of the dam is protected by riprap at the normal reservoir level. Some sloughing of the riprap was observed at the time of inspection. No seepage, surface cracking, or movement at the toe was observed during the inspection. The junction of the left and right abutments with natural ground appears to be in good condition. There is no internal drainage system for the dam.
- d. Outlet Works - The control for the outlet pipe gate, located on top of the gate house, is rusty

but able to be operated. According to the owner, the gate was opened and closed within the last year. The gate house and outlet pipe appear to be in good condition. The outlet works channel (as shown in Photo 6) is in good condition.

- e. Downstream Channel - The downstream channel is a natural stream located in a wooded, somewhat narrow valley (as shown in Photo 6). The stream slope is shallow, approximately 0.6 percent.
- f. Reservoir - The slopes immediately adjacent to the reservoir are moderate and well vegetated. Sedimentation is minor, as soundings taken during the inspection indicate the reservoir depth is from 13 feet to 15 feet. There were no reservoir monitoring instruments observed.
- g. Appurtenant Structures - The concrete top for the springhouse, located on the right side of the dam, is cracked.

3.2 EVALUATION

The visual inspection revealed several deficiencies in this structure. The following were noted:

- 1. On the left side of the spillway masonry wall, the crest is eroded to the top of the concrete core wall.
- 2. The upstream ends of the spillway wingwalls are undercut.
- 3. Debris is in the spillway discharge channel.
- 4. The entire upstream face, crest, and downstream face of the embankment are covered with brush and trees.
- 5. There are several uprooted trees on the embankment.
- 6. Some sloughing of the riprap on the upstream face was observed.
- 7. The crest width of the embankment varies from 3.0 to 4.5 feet.
- 8. There are some minor cracks in the masonry walls of the spillway discharge channel.

9. There are cracks in the concrete cap of the spring-house.
10. The concrete caps for the masonry walls at the spillway weir are missing.
11. There are no reservoir monitoring instruments.

SECTION 4: OPERATION AND MAINTENANCE PROCEDURES

4.1 PROCEDURES

The operation of the dam is an automatic function controlled by the crest of the spillway.

4.2 MAINTENANCE OF THE DAM

Maintenance of the dam is the responsibility of the owner. There are no formal inspection or maintenance procedures for Willow Brook Dam.

4.3 WARNING SYSTEM

There is no warning procedure or emergency action plan in the event of dam failure.

4.4 EVALUATION

It is recommended that formal inspection and maintenance procedures be developed and implemented. Maintenance items should be corrected annually. A warning system and emergency action plan should be developed and implemented.

SECTION 5: HYDRAULIC/HYDROLOGIC

5.1 DRAINAGE AREA CHARACTERISTICS

Delineation of the watershed above Willow Brook Dam was made using the Monroe, New York USGS 7.5 minute quadrangles. The drainage basin is comprised of about 10% residential development, 7% lake surface, and 83% wooded land. Slopes in the reservoir are mostly moderate, about 8% to 15%. The total drainage area of Willow Brook Dam is 1.34 square miles. A Watershed Map is shown in Appendix E.

5.2 ANALYSIS CRITERIA

An hydrologic analysis of the watershed and hydraulic analysis of the dam was conducted using the U.S. Army Corps of Engineers' Flood Hydrograph Package HEC-1 DB computer program (Reference 10, Appendix D). The unit hydrograph was defined using the Snyder Unit Hydrograph Method. Estimates of Snyder hydrograph coefficients were based upon average coefficients from the Hydrologic Flood Routing Model for Lower Hudson River Basin (Reference 13, Appendix D). Rainfall losses were estimated at an initial loss of 1.0 inch and a constant loss rate of 0.1 inch per hour thereafter. The hydraulic capacity of the dam, reservoir, and spillway was determined by incorporating the Modified Puls Routing Method. All flood routings were begun with the reservoir at normal pool level. The Probable Maximum Flood (PMF) and 1/2 Probable Maximum Flood (1/2 PMF) were developed and routed through the reservoir.

5.3 SPILLWAY CAPACITY

The capacity of the spillway at the minimum top of dam (elev. 588.2 ft.) for the existing conditions was determined to be 425 cubic feet per second (c.f.s.). With the low area adjacent to the spillway filled in, the spillway capacity at the minimum top of dam (elev. 589.4 ft.) was determined to be 741 c.f.s.

5.4 RESERVOIR CAPACITY

The storage capacity of Willow Brook Dam at normal pool is 841 acre-feet. The storage capacity of the reservoir at the minimum top of dam is 1061 acre-feet. Therefore, flood control storage of the reservoir between the

spillway crest and top of dam is 220 acre-feet. This volume represents a total of 3.08 inches of runoff from the watershed.

5.5 FLOODS OF RECORD

No records concerning the effects of significant floods on the dam and spillway are available.

5.6 OVERTOPPING POTENTIAL

The peak outflow of the PMF is 2718 c.f.s. and the 1/2-PMF is 872 c.f.s. The maximum capacity of the spillway is 425 c.f.s. for existing conditions, resulting in a spillway capacity of 28 percent of the PMF. With the low area adjacent to the spillway filled in, the maximum spillway capacity is 741 c.f.s., resulting in a spillway capacity of 45 percent of the PMF.

5.7 RESERVOIR EMPTYING POTENTIAL

The reservoir can be drawn down by means of a 24-inch cast iron pipe as described in Section 1.2a. Neglecting inflow, the reservoir can be drawn down from normal pool in approximately 352 hours or 14.7 days. This is equivalent to an approximate drawdown rate of 1 foot per day, based on the hydraulic height measured from normal pool divided by the time to dewater the reservoir.

5.8 EVALUATION

It was determined that the spillway is capable of passing 28% of the PMF for existing conditions or 45% of the PMF, assuming the low area adjacent to the spillway is filled without overtopping the dam. The spillway is, therefore, judged to be "seriously inadequate".

Conclusions pertain to present conditions, and the effect of future development on the hydrology has not been considered.

SECTION 6: STRUCTURAL STABILITY

6.1 EVALUATION OF EMBANKMENT STABILITY

- a. Visual Observations - No signs of potential instability were observed during the visual inspection of Willow Brook Dam. Minor problems observed which could affect the stability of the structure include:
 1. A low area of the dam crest on the left side of the spillway would provide a channel for water to erode the embankment during future periods of high lake level. It appears that the embankment material at this point has been eroded away, thus exposing the top of the concrete core wall.
 2. The upstream spillway wing walls have been undercut.
 3. Some sloughing of the upstream riprap face has occurred, however, it did not appear, during the inspection, to be a major problem or an indication of major instability.
 4. The entire dam was covered with trees and brush which should be removed.
 5. Four overturned trees were observed on the embankment. The overturned trees have created depressions in the embankment which should be redressed.
- b. Design and Construction Data - No design and construction information relating to stability of the embankment is available for Willow Brook Dam. A force diagram of the concrete spillway section of the dam was made for application of the dam construction permit and is included in Appendix F. No calculations of overturning or sliding stability were provided with this force diagram.
- c. Operating Records - The gate valve is operated as needed to reduce the lake level approximately once a year. No formal inspections of the dam are made.
- d. Post Construction Changes - No changes have been made to the dam since the completion of construction in late 1926.

6.2 STABILITY ANALYSIS

The results of previous stability analyses, if any, were not available for the embankment portion of Willow Brook Dam. As previously mentioned, a force diagram was provided for the concrete spillway portion of the dam.

The dam appears to be a relatively homogeneous embankment composed largely of sandy silt with gravel (estimated to be ML Group Soils - Unified Classification System). The original plans for Willow Brook Dam indicate a concrete core wall was placed in the center of the embankment. The top of the core wall appeared to be exposed next to the left spillway wall. Willow Brook Dam is 18.5 feet high with a crest width of 3 to 4.5 feet. The upstream slope of the embankment is 1V:2.2H while the downstream slope is 1V:2.1H. The upstream slope is protected with riprap to just above normal pool level. The crest width is varied, and a footpath is worn on the crest. The dam can be drawn down at the rate of approximately 1 foot per day and is, therefore, subject to rapid drawdown (greater than 0.5 feet drop in the reservoir level per day) as determined by hydraulic calculations made during this investigation.

There are no signs of major instability, based on the overall condition of the dam as observed during the visual inspection. Therefore, a stability analysis is not considered necessary.

6.3 SEISMIC STABILITY

This dam is located in Seismic Zone 1 which presents no hazard from earthquakes, according to the Recommended Guidelines for Safety Inspection of Dams. This determination is contingent on the requirements that static stability conditions are satisfactory and conventional safety margins exist.

SECTION 7: ASSESSMENT/RECOMMENDATIONS

7.1 ASSESSMENT

- a. Safety - The Phase I Inspection of Willow Brook Dam revealed that the spillway is "seriously inadequate", based on the Corps of Engineers screening criteria. Outflows from any storm in excess of 28 percent of the PMF will overtop the dam. For this reason, the dam has been assessed as unsafe, non-emergency.

The classification of "unsafe", applied to a dam because of a "seriously" inadequate spillway, is not meant to connote the same degree of emergency as would be associated with an "unsafe" classification applied for a structural deficiency. It does mean, however, that based on an initial screening, and preliminary computations, there appears to be a serious deficiency in spillway capacity so that if a severe storm were to occur, overtopping and failure of the dam would take place, significantly increasing the hazard to loss of life downstream from the dam.
- b. Adequacy of Information - All evaluations and assessments in this report were based on field observations, conversations with the owner's representative, available engineering data, and office analyses. The information collected is considered adequate for a Phase I Inspection.
- c. Need for Additional Information - Detailed hydrologic and hydraulic investigations of the structure are considered necessary to determine the appropriate mitigating measures in response to the spillway inadequacy.
- d. Urgency - The detailed hydrologic and hydraulic investigations must be initiated within three months of notification to the owner. Within one year, remedial measures resulting from these investigations must be initiated with completion of these measures during the following year. In the interim, a detailed emergency action plan must be developed and implemented during periods of unusually heavy precipitation. Around the clock surveillance must also be provided during these periods. The problem areas listed below must be corrected within one year of notification.

7.2 RECOMMENDED MEASURES

Regular inspections and maintenance procedures should be developed and implemented. A thorough checklist should be compiled by the owner or the owner's representative and completed during each inspection. Maintenance items should be completed annually. The reservoir level should be monitored and some type of records maintained.

The following remedial measures must be completed within one year:

1. The low area of the dam crest on the left side of the spillway should be filled to the average elevation of the top of dam, 590.0 M.S.L.
2. The deterioration in the spillway wing walls should be repaired and rock riprap should be placed at the junction of the wing walls and dam to prevent undercutting.
3. All debris should be removed from the spillway discharge channel.
4. The riprap on the upstream face should be redressed and extended to the crest of the dam.
5. The crest of the dam should be regraded and leveled to elevation 590.0 M.S.L. with a width of at least 5 feet.
6. All brush and trees should be cut off at ground level over the entire dam and the embankment mowed regularly. The root systems should be removed for trees with a trunk diameter greater than 3 inches and the resultant cavities backfilled, compacted, and seeded.
7. The uprooted trees should be removed, and the depressions left should be backfilled, compacted, and seeded.
8. The cracks in the spillway discharge channel walls should be repaired and joints repointed as necessary.
9. The missing concrete caps for the masonry walls at the spillway weir should be replaced.

10. The cracks in the concrete top of the springhouse should be repaired.
11. A staff gage should be installed to monitor reservoir levels above normal pool.

APPENDIX A
PHOTOGRAPHS

CONTENTS

- Photo 1: Upstream Face of Dam. Concrete Springhouse and Concrete Gate House.
- Photo 2: Downstream Face of Dam
- Photo 3: Uprooted Tree of Upstream Slope
- Photo 4: Spillway
- Photo 5: Spillway Discharge Channel and Rock Rubble Falls Below Spillway
- Photo 6: Confluence of Spillway Discharge Channel and Outlet Works Discharge Channel. Natural Stream Downstream of Dam.

Note: Photographs were taken on 9 March 1981.

WILLOW BROOK DAM



Photo 1. Upstream Face of Dam. Concrete Cap
for Springhouse and Concrete Gatehouse.

9 March 1981



Photo 2. Downstream Face of Dam

9 March 1981

WILLOW BROOK DAM

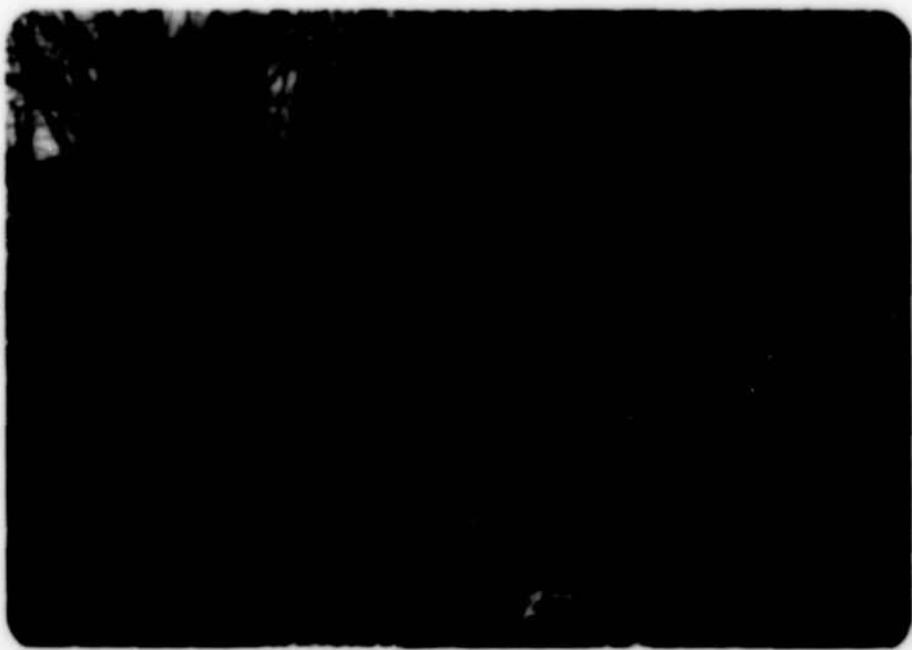


Photo 3. Uprooted Tree on Upstream Slope
9 March 1981



Photo 4. Spillway
9 March 1981

WILLOW BROOK DAM



Photo 5. Spillway Discharge Channel and Rock
Rubble Falls below Spillway
9 March 1981



Photo 6. Confluence of Spillway Discharge Channel and
Outlet Works Discharge Channel. Natural
Stream Downstream of Dam.
9 March 1981

APPENDIX B
VISUAL INSPECTION CHECKLIST

VISUAL INSPECTION CHECKLIST

1) Basic Data

a. General

Name of Dam Willow Brook Dam

Fed. I.D. # NY 00035

DEC Dam No. 195C-450

River Basin Lower Hudson

Location: Town Blooming Grove County Orange

Stream Name Unnamed

Tributary of Moodna Creek

Latitude (N) 41° 20.9' Longitude (W) 74° 11.8'

Type of Dam Earthfill with concrete core wall

Hazard Category High

Date(s) of Inspection 5 March 1981, 9 March 1981

Weather Conditions Cloudy and snowy, 30° F.-33° F.

Reservoir Level at Time of Inspection 585.1 M.S.L.*

b. Inspection Personnel Terry S. Hawk, Gary W. Todd, Larry A. Diday

c. Persons Contacted (Including Address & Phone No.) 914-343-5324

George Begbie

Orange and Rockland Utilities, Inc.

71 Dolson Avenue

Middletown, NY 10940

d. History:

Date Constructed Fall of 1925 Date(s) Reconstructed Spring, Summer, and Fall of 1926

Designer Knight, Bush, and Thompson Engineering, Monroe, NY

Constructed By Orange and Rockland Electric Co.

Owner Orange and Rockland Utilities, Inc.

*Mean Sea Level Datum

2) Embankment

a. Characteristics

(1) Embankment Material Homogenous earthfill

(2) Cutoff Type _____

(3) Impervious Core Concrete core wall underneath entire earth embankment.

(4) Internal Drainage System None observed

(5) Miscellaneous _____

b. Crest

(1) Vertical Alignment The crest varies in elevation from a low spot on the left side of the spillway, 588.2 M.S.L., to the maximum top of dam, 590.2 M.S.L. The average top of dam is elevation 590.0 M.S.L.

(2) Horizontal Alignment The crest width varies from about 3.0 ft. to 4.5 ft.

(3) Surface Cracks None observed

(4) Miscellaneous Most of the crest of the dam is covered with brush and trees. A footpath is located on the upstream side of the crest. On the left side of the spillway wall, the crest is eroded to the top of the concrete core wall.

c. Upstream Slope

(1) Slope (Estimate) (V:H) 1V:2.2H

(2) Undesirable Growth or Debris, Animal Burrows The entire upstream slope is covered with brush and trees. There is also 1 uprooted tree on the upstream face.

- (3) Sloughing, Subsidence, or Depressions A depression exists from the uprooted tree. There appears to be some sloughing or subsidence of the riprap at normal pool level.
- (4) Slope Protection The upstream face is protected with rock riprap to just above normal pool level.
- (5) Surface Cracks or Movement at Toe Unobservable at time of inspection.

d. Downstream Slope

- (1) Slope (Estimate - V:H) 1V : 2.1H
- (2) Undesirable Growth or Debris, Animal Burrows The entire downstream slope is covered with brush and trees. There are also 3 uprooted trees on the downstream face.
- (3) Sloughing, Subsidence or Depressions Depressions exist from the 3 uprooted trees. No sloughing or subsidence was observed.
- (4) Surface Cracks or Movement at Toe None observed.
- (5) Seepage None observed at time of inspection
- (6) External Drainage System (Ditches, Trenches, Blanket) None observed
- (7) Condition Around Outlet Structure The masonry wall with a concrete cap adequately encases the 24-in. diameter outlet pipe.

(8) Seepage Beyond Toe None observed

e. Abutments - Embankment Contact: The junctions of the left and right dam abutments with natural ground appear to be in good condition, however, they are completely covered with trees and brush.

(1) Erosion at Contact None observed

(2) Seepage Along Contact None observed

3) Drainage System

8. Description of System There is no drainage system for the dam.

b. Condition of System

c. Discharge from Drainage System

4) Instrumentation (Monumentation/Surveys, Observation Wells, Weirs, Piezometers, Etc.) None observed

5) Reservoir

- a. Slopes The slopes immediately adjacent to the reservoir are moderate, about 8% and are mostly well vegetated.
- b. Sedimentation Sedimentation is minor. Soundings indicate the reservoir is about 13 to 15 ft. deep.
- c. Unusual Conditions Which Affect Dam None observed

6) Area Downstream of Dam

- a. Downstream Hazard (No. of Homes, Highways, etc.) Three homes are located about 1 mile downstream of the dam. A fourth home and an apartment complex are located 1.4 and 1.5 miles, respectively, downstream of the dam.
- b. Seepage, Unusual Growth None observed
- c. Evidence of Movement Beyond Toe of Dam None observed
- d. Condition of Downstream Channel The downstream channel is a natural stream located in a wooded, somewhat narrow valley. The stream has some minor debris in the channel and the slope is shallow, approximately 0.6 percent.

7) Spillway(s) (Including Discharge Conveyance Channel)

- a. General The rectangular shaped spillway consists of a concrete weir and concrete sides, faced with stone. The weir is broadcrested and has a length of 25 ft. and breadth of 3 ft.. The upstream face of the weir is inclined about 45° and the downstream face is vertical and has two concrete steps, each 1 ft. wide by 2 ft. high.
- b. Condition of Service Spillway The spillway is in good condition with no deterioration observed. The upstream ends of the wingwalls are undermined and are showing signs of deterioration. The concrete caps for the masonry walls at the spillway crest are missing.
- c. Condition of Auxiliary Spillway None observed
- d. Condition of Discharge Conveyance Channel The discharge channel consists of masonry paved bottom and sides capped with concrete. The channel is in good condition with some minor cracks in the walls above normal water level. There is some debris, tree branches and boards in the channel.

8) Reservoir Drain/Outlet

Type: Pipe Conduit _____ Other _____

Material: Concrete _____ Metal _____ Cast Iron _____ Other _____

Size: 24-in. diameter _____ Length Approximately 80 feet

Invert Elevations: Entrance 570.0 M.S.L. Estimated

Exit 569.66 M.S.L.

Physical Condition (Describe): Unobservable

Material: Outlet appears to be in good condition.

Joints: Unobservable Alignment Unobservable

Structural Integrity: Structural integrity should be satisfactory

Hydraulic Capability:

Means of Control: Gate Valve _____ Uncontrolled _____

Operation: Operable Inoperable _____ Other _____

Present Condition (Describe): The control for the gate is rusty but, according to the owner's representative, it has been operated within the last year. The concrete gatehouse contains the outlet gate and appears to be in good condition.

9) Structural - Not Applicable

a. Concrete Surfaces

b. Structural Cracking

c. Movement - Horizontal & Vertical Alignment (Settlement)

d. Junctions with Abutments or Embankments

- e. Drains - Foundation, Joint, Face _____

- f. Water Passages, Conduits, Sluices _____

- g. Seepage or Leakage _____

- h. Joints - Construction, etc. _____

- i. Foundation _____

- j. Abutments _____

- k. Control Gates _____

1. Approach & Outlet Channels _____

2. Energy Dissipators (Plunge Pool, etc.) _____

3. Intake Structures _____

4. Stability _____

5. Miscellaneous _____

10) Appurtenant Structures (Power House, Lock, Gatehouse, Other)

- a. Description and Condition A concrete structure, containing a spring-house, is located on the right upstream side of the dam. The concrete top for this structure is cracked in several places.

APPENDIX C
HYDROLOGIC/HYDRAULIC DATA AND COMPUTATIONS

MICHAEL BAKER, JR., INC.

THE BAKER ENGINEERS

Box 280
Beaver, Pa. 15009

Subject Willow Branch Dam S.O. No. _____
APPENDIX C - HYDROLOGIC / Sheet No. _____ of _____
HYDRAULIC CALCULATIONS: Drawing No. _____
Computed by _____ Checked by _____ Date _____

<u>SUBJECT</u>	<u>PAGE</u>
CHECK LIST FOR DAMS	1
DRAINAGE AREA AND CENTROID MAP	5
HYDRAULIC AND HYDROLOGIC DATA	6
TOP OF DAM PROFILE AND CROSS SECTION	7
SPILLWAY DISCHARGE RATING	8
24-INCH PIPE RATING	9
SPILLWAY CAPACITY ANALYSIS	14
HEC-1 COMPUTER ANALYSIS	15

CHECK LIST FOR DAMS
HYDROLOGIC AND HYDRAULIC
ENGINEERING DATA

AREA-CAPACITY DATA:

	<u>Elevation</u> (ft.)	<u>Surface Area</u> (acres)	<u>Storage Capacity</u> (acre-ft.)
1) Top of Dam	588.2	76.0	1,061
2) Design High Water (Max. Design Pool)	--	--	--
3) Auxiliary Spillway Crest	--	--	--
4) Pool Level with Flashboards	--	--	--
5) Service Spillway Crest	585.0	63.4	841

DISCHARGES

	<u>Volume</u> (cfs)
1) Average Daily	5 - 10
2) Spillway @ Maximum High Water - Top of Dam -	425
3) Spillway @ Design High Water	--
4) Spillway @ Auxiliary Spillway Crest Elevation	--
5) Low Level Outlet	55
6) Total (of all facilities) @ Maximum High Water	478
7) Maximum Known Flood	Unknown
8) At Time of Inspection	5 - 10

CREST:

ELEVATION: 588.2 ft.

Type: Earth Embankment

Width: 3 ft. to 4.5 ft.

Length: 540 ft.

Spillover Broad-crested weir

Location 100 ft. from left abutment

SPILLWAY:

SERVICE

585.0 ft.

Elevation

None

Broad-crested weir

Type

Width

Type of Control

X

Uncontrolled

Controlled:

-- Type

(Flashboards; gate)

-- Number

-- Size/Length

Invert Material

Anticipated Length
of Operating Service

-- Chute Length

1.3 ft.

Height Between Spillway Crest
& Approach Channel Invert
(Weir Flow)

HYDROMETEROLOGICAL GAGES:

Type: None

Location: _____

Records: _____

Date: _____

Max. Reading: _____

FLOOD WATER CONTROL SYSTEM:

Warning System: None

Method of Controlled Releases (mechanisms):

24" blow-off pipe at toe of dam controlled by a valve in the gatehouse

DRAINAGE AREA: 1.34 sq. mi.

DRAINAGE BASIN RUNOFF CHARACTERISTICS:

Land Use - Type: About 10% residential, 7% lake surface, 83% wooded

Terrain - Relief: Moderate, about 3% to 15% slopes

Surface - Soil: Poor permeability

Runoff Potential (existing or planned extensive alterations to existing surface or subsurface conditions)

There were no known plans for altering the existing runoff patterns at the time of the inspection.

Potential Sedimentation problem areas (natural or man-made; present or future)

None observed. All slopes well-vegetated.

Potential Backwater problem areas for levels at maximum storage capacity including surcharge storage:

Orange and Rockland Utilities, Inc. building is subject to flooding if the reservoir rises substantially.

Dikes - Floodwalls (overflow & non-overflow) - Low reaches along the Reservoir perimeter:

Location: None

Elevation:

Reservoir:

Length @ Maximum Pool 5,500 ft. (Top of Dam El. 590.0 M.S.L.)

Length of Shoreline (@ Spillway Crest) 15,000 ft.



1" = 2000'

Willow Brook Dam
Drainage Area Map

MICHAEL BAKER, JR., INC.
THE BAKER ENGINEERS
Box 380
Baker, Pa. 15009

Subject N.Y. Dam F 15.2
Willow Break Dam
(Orange, Pennsylvania Lakes)
Computed by S.S.

S.O. No. 13880-00-A-03
Sheet No. 6 of 29
Drawing No. _____
Date 11/4/81

Drainage Area

$$\text{Monroe Quad} = 20.09/3 \cdot 9.36 \text{ in}^2 = 859.5 \text{ Ac.} = 1.34 \text{ mi}^2$$

Surface Areas

$$\begin{aligned}\text{Lakes @ cl 565} &= 2.07/3 \cdot 0.69 \text{ in}^2 = 63.4 \text{ Ac.} = 0.10 \text{ mi}^2 \\ \text{cl 600} &= 4.00/3 \cdot 1.33 \text{ in}^2 = 122.4 \text{ Ac.} = 0.19 \text{ mi}^2 \\ \text{cl 620} &= 7.00/3 \cdot 2.33 \text{ in}^2 = 214.3 \text{ Ac.} = 0.33 \text{ mi}^2\end{aligned}$$

$$\begin{aligned}C_f &= 2.0 \quad C_p = 0.63 \\ T_d &= C_f (L + L_{eq})^{0.5} \\ &= 2.0(2.59 + 0.85)^{0.5} \\ &= 2.53\end{aligned}$$

Watershed Lengths

$$\begin{aligned}L &= 13,650 \text{ ft.} = 2.59 \text{ mi} \\ L_c &= 4,500 \text{ ft.} = 0.85 \text{ mi}\end{aligned}$$

$$\begin{aligned}\text{ADJUSTMENT FOR } T_d \text{ USING} \\ \text{A PURATION INTERVAL OF 30 min.} \\ t_{eq} &= 5 + \frac{L - L_c}{2} \\ &= 2.53 + \frac{0.5 - 0.85}{4} \\ t_{eq} &= 2.54\end{aligned}$$

Precipitation Data

HMR-33 Zone 1

$$\text{PMP 24 hr.} - 200 \text{ mi}^2 = 21.5 \text{ inches}$$

D.A. Less than 10 mi²

Duration	<u>96 or 200 mi²</u>	<u>inches</u>
6 hr. PMP	111	23.9
12 hr. "	123	26.4
24 hr. "	133	28.6
48 hr. "	182	30.5

TP-40


$$\begin{aligned}100 \text{ yr. - 24 hr Rainfall} &= 7.5 \text{ inches} \\ \cdot 12 \text{ hr.} &= 6.4 " \\ \cdot 6 \text{ hr.} &= 5.3 "\end{aligned}$$

MICHAEL BAKER, JR., INC.
THE BAKER ENGINEERS


Box 280
Beaver, Pa. 15009

Subject New York Dams S.O. No. _____
Willow Brook Dam Sheet No. 7 of 29
Composed by LAD Drawing No. _____
Checked by Guy T Date 2/12/51

TOP OF DAM PROFILE

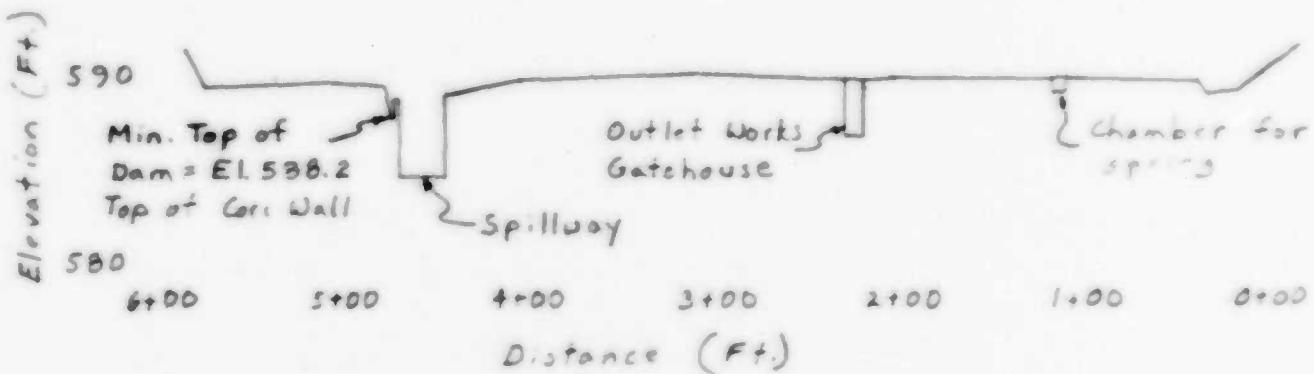

TYPICAL DAM CROSS SECTION AT STA. 2+14

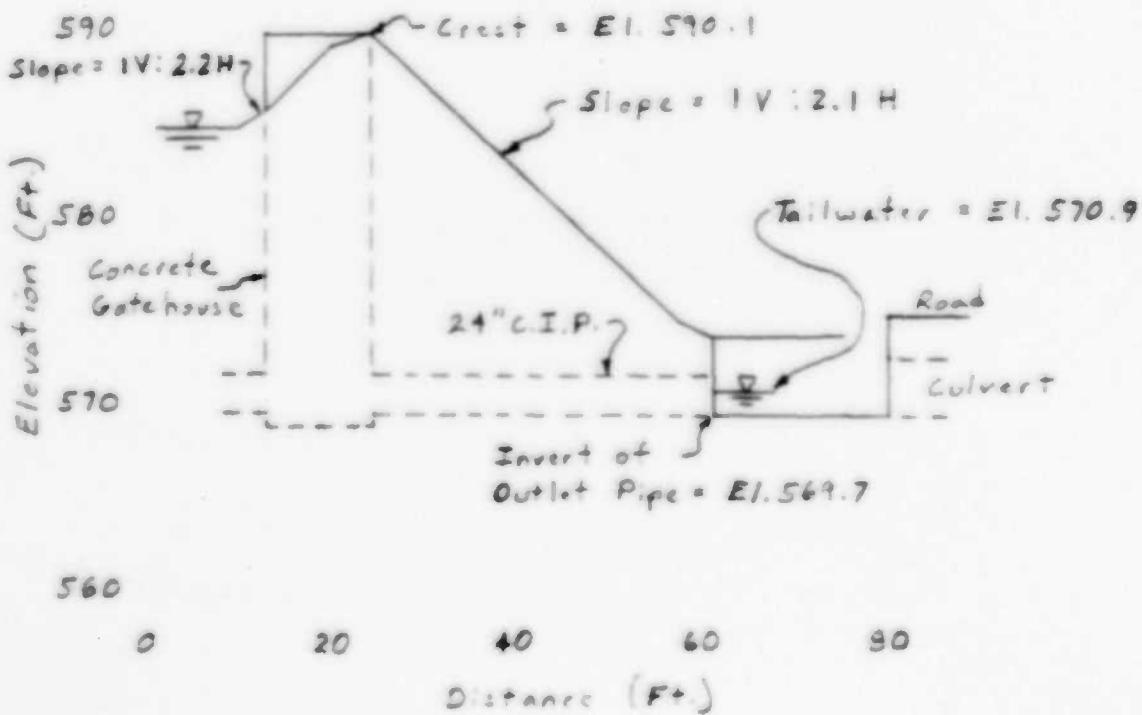

MICHAEL BAKER, JR., INC.
THE BAKER ENGINEERS
Box 280
Beaver, Pa. 15009

Subject New York Inn S.O. No. _____
Edison Electric Co. Sheet No. B of 29
Spillway, Existing Drawing No. _____
Computed by JED Checked by GWT Date 3/12/91

Weir Flow

$$Q = CLH^{3/2}$$

$$L = 25'$$

$$\text{Breadth} = 3'$$

C varies with H from 0.2 to 0.4
Brater Handbook Table 5-3
and 5-4 Pg 5-40


H varies from 0.2 Ft to 8.0 Ft

Elevation (Ft.)	H (Ft.)	C	L (Ft.)	Q (cfs)
585.0	0		25.0	0
585.2	0.2	2.4	25.0	5.4
585.6	0.6	2.7	25.0	31.4
586.0	1.0	2.7	25.0	67.5
587.0	2.0	2.7	25.0	190.9
588.0	3.0	2.9	25.0	376.7
589.0	4.0	3.1	25.0	620.0
590.0	5.0	3.3	25.0	922.4
591.0	6.0	3.3	25.0	1212.5
592.0	7.0	3.3	25.0	1527.9
593.0	8.0	3.3	25.0	1866.8

MICHAEL BAKER, JR., INC.
THE BAKER ENGINEERS

Box 280
Beaver, Pa. 15009

Subject Willow Brooke Dam S.O. No. _____
24-in. CAST IRON PIPE RATING Sheet No. 9 of 29
Drawing No. _____
Computed by GWT Checked by LAD Date 3-18-81

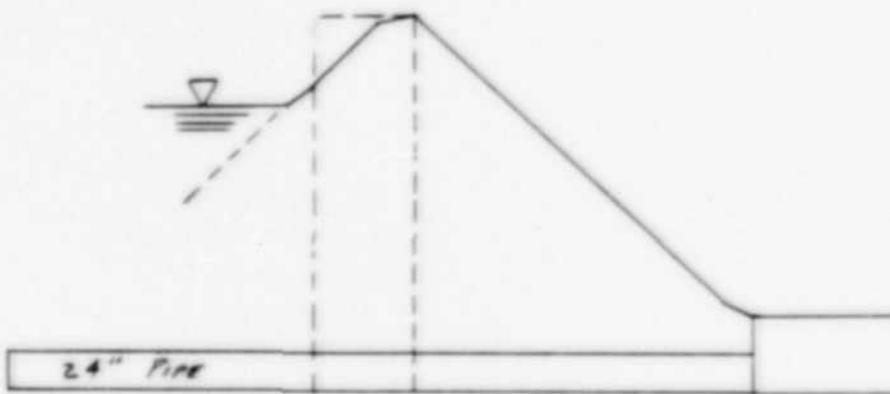


OUTLET PIPE IS 24" CAST IRON PIPE -
INLET ELEV. 570.00 FT. /
OUTLET ELEV. 569.66 FT. /
LENGTH = 80 FT. /
SPILLWAY CROSS ELEV. 585.0 FT. -

MICHAEL BAKER, JR., INC.
THE BAKER ENGINEERS

Box 330
Brown, Pa. 15029

Subject Willow Brook Park S.O. No.
24-in. Cast Iron Pipe Ratings Sheet No. 10 of 29
Drawing No.
Computed by GWT Checked by 602 Date 2-10-81

"DESIGN OF SMALL DOORS" PAGES 558 AND 559

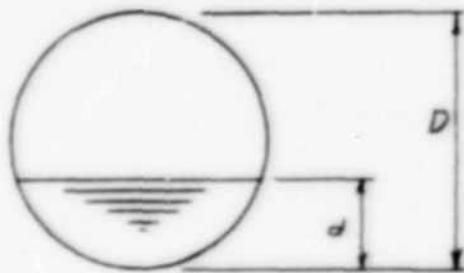

D. D. M. P. M.

d: DEPTH OR WATER

50 PIPE SCOPE

$$S = \frac{570.00 - 569.66}{80} = 0.0043$$

- 0.012 -

$$\frac{d}{D} \cdot \frac{1}{2} \cdot .5 \quad \text{TABLE B-2} \quad 1.3955 \cdot \frac{0.8}{0.6} \cdot \frac{9}{2.6} \quad Q = 7.89 \text{ c.p.s.}$$

$$\frac{d}{D} = \frac{1}{2} + .5 \quad \text{Table B-3} \quad .232 \cdot \frac{Q(0)}{D^2 S^2} = \frac{Q(0.013)}{(2)^2 (0.009) D} \quad Q = 7.43 \text{ GFS.}$$

$$\frac{d}{P} = \frac{1.5}{2} + .75 \text{ Trace B-2 } 3.0607 = \frac{q_2}{P_{50}} + \frac{Q}{2A} \quad Q = 17.31 \text{ C.F.S.}$$

$$\frac{d}{D} = \frac{1.5}{2} = .75 \quad \text{TABLE B-3} \quad .422 \cdot \frac{q^{\infty}}{p^{m_s n}} = \frac{q(.013)}{(2p^m(0.004))^n} \quad Q = 13.52 \text{ cfs}$$

Subcritical Flow Controls

MICHAEL BAKER, JR., INC.
| THE BAKER ENGINEERS

Box 230
Pittsford, N.Y. 14535

Subject Willow Brook Ditch S.O. No. _____
24-in Cast Iron Pipe Rating Sheet No. 11 of 29
Drawing No. _____
Computed by GWT Checked by GAD Date 3-18-81

$$\text{Orifice Flow}$$

$$Q = CA (2gH)^{0.5}$$

$$Q = 15.12 (H)^{0.5} \text{ l}$$

$R = \pi R^2 = \pi(1)^2 = 3.14 \text{ ft}$
 $g = 32.2 \text{ ft/sec}^2$
HURRICANE FROM 1.5 TO 172 FT.
 $C = 0.6$ FROM TABLE 4-6 Pg. 492
BENTON & KING

HEAD MEASURED TO CENTER OF PIPE

ELEVATION (FT)	C	P (S.G. FT)	L (PT/sec)	H (FT)	C (%)
573.0	.6	3.14	60.4	2.0	21.35%
574.0	.6	3.14	60.4	3.0	26.19%
576.0	.6	3.14	60.4	5.0	33.81%
578.0	.6	3.14	60.4	7.0	40.00%
580.0	.6	3.14	60.4	9.0	45.26%
582.0	.6	3.14	60.4	11.0	50.15%
584.0	.6	3.14	60.4	13.0	54.52%
586.0	.6	3.14	60.4	15.0	58.56%
588.2	.6	3.14	60.4	17.2	62.71%

MICHAEL BAKER, JR., INC.
THE BAKER ENGINEERS

Box 280
Beaver, Pa. 15009

Subject Willow Brook Ditch S.O. No. _____
24-in CAST IRON PIPE RATING Sheet No. 12 of 29

Composed by GWT Checked by GAD Drawing No. _____
Date 2-18-81

PIPE FLOW

$$Q = \frac{A (2gH)^n}{D + K_0 + K_s + K_e (L)}^n$$

$$= \frac{3.14 (64.4 H)^n}{[D + .78 + 0 + .0124 (80)]^n}$$

$$Q = 15.13 \text{ H}^n /$$

$D = \pi R^2 = 3.14 /$
 $g = 32.2 \text{ FT/SEC}^2 /$
 $H \text{ VARIES AND IS MEASURED FROM -}$
 $\text{THE TOP OF PIPE ELEV. PI}$
 THE OUTLET
 $L = 80 \text{ FT.}$
 $K_e (K_s) = .78 \text{ Pg. 5.5-6 -}$
 SCS NEN-5
 $K_0 (K_f) = 0 \text{ Pg. 5.5-10 -}$
 SCS NEN-5
 $K_e (L_e) = 0.0124 \text{ Pg. 5.5-6 -}$
 SCS NEN-5
 $n = 0.013 /$

TOP OF 24" PIPE AT
OUTLET - ELEV. 571.66 FT. /

ELEVATION (FT.)	H (FT)	Q (CFS)
573.0	1.34	17.5 /
574.0	2.34	23.1 /
576.0	4.34	31.5 /
578.0	6.34	30.1 /
580.0	8.34	42.7 /
582.0	10.34	48.7 /
584.0	12.34	59.2 /
586.0	14.34	57.3 /
588.0	16.34	61.5 /

MICHAEL BAKER, JR., INC.

THE BAKER ENGINEERS

Box 380
Beaver, Pa. 15009

Subject Willow Brook Dam S.O. No. _____
24-in PIPE RATING SUMMARY Sheet No. 13 of 29
Drawing No. _____
Computed by GWT Checked by KPD Date 2-10-81


24" PIPE RATING SUMMARY

Elevation (ft)	Q (cfs)
570.0	0
571.0	7.4 -
571.5	13.5 -
572.0	17.5 -
572.5	23.1 -
573.0	31.5 -
573.5	38.1 -
574.0	43.7 -
574.5	48.7 -
575.0	53.2 -
576.0	57.3 -
576.2	61.5 -

MICHAEL BAKER, JR., INC.
THE BAKER ENGINEERS

Box 280
Brent, Pa. 15020

Subject Willow Branch Dam S.O. No. _____
Spillway Capacity Analysis Sheet No. 14 of 29
Composed by GWT Checked by WCD Date 5/6/81
Drawing No. _____

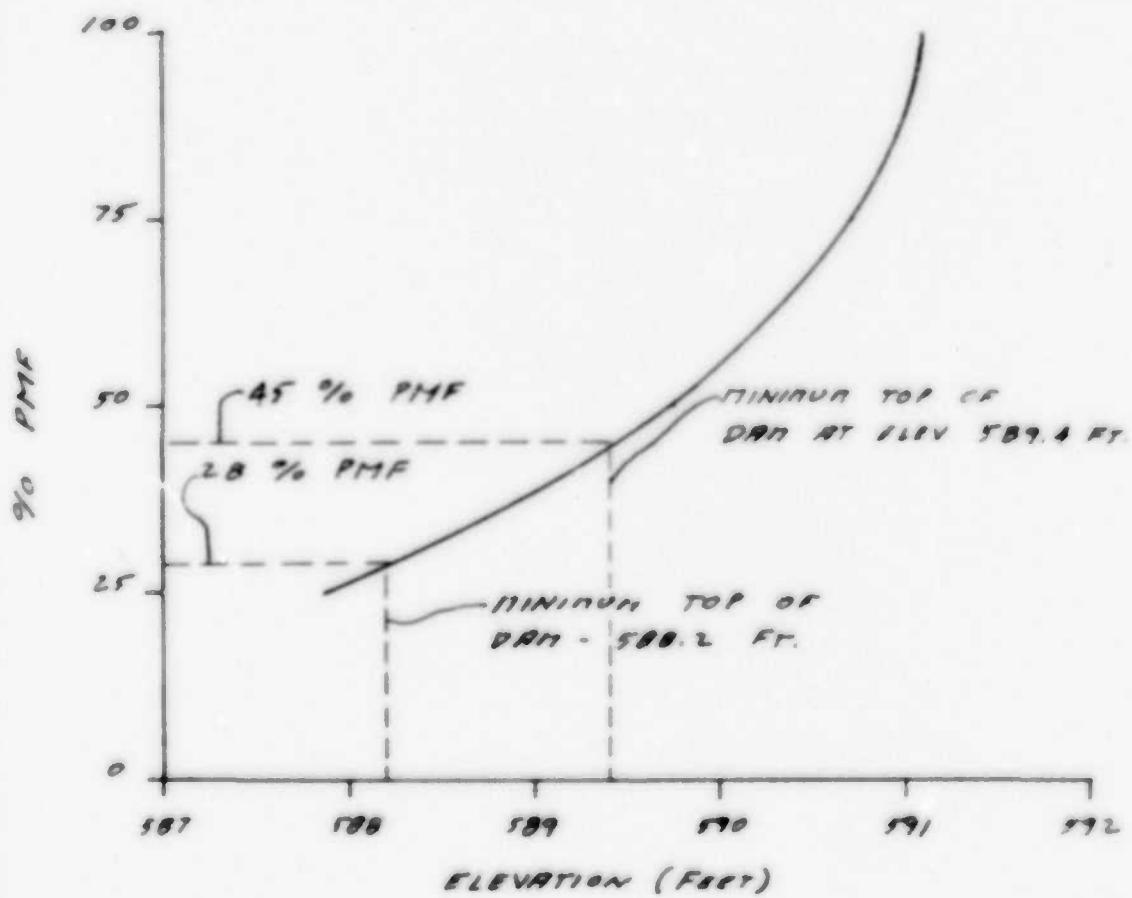

11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27
28
29
30
31
32
33
34
35
36
37
38
39
40
41
42
43
44
45
46
47
48
49
50
51
52
53
54
55
56
57
58
59
60
61
62
63
64
65
66
67
68
69
70
71
72
73
74
75
76
77
78
79
80
81
82
83
84
85
86
87
88
89
90
91
92
93
94
95
96
97
98
99
100
101
102
103
104
105
106
107
108
109
110
111
112
113
114
115
116
117
118
119
120
121
122
123
124
125
126
127
128
129
130
131
132
133
134
135
136
137
138
139
140
141
142
143
144
145
146
147
148
149
150
151
152
153
154
155
156
157
158
159
160
161
162
163
164
165
166
167
168
169
170
171
172
173
174
175
176
177
178
179
180
181
182
183
184
185
186
187
188
189
190
191
192
193
194
195
196
197
198
199
200
201
202
203
204
205
206
207
208
209
210
211
212
213
214
215
216
217
218
219
220
221
222
223
224
225
226
227
228
229
230
231
232
233
234
235
236
237
238
239
240
241
242
243
244
245
246
247
248
249
250
251
252
253
254
255
256
257
258
259
260
261
262
263
264
265
266
267
268
269
270
271
272
273
274
275
276
277
278
279
280
281
282
283
284
285
286
287
288
289
290
291
292
293
294
295
296
297
298
299
300
301
302
303
304
305
306
307
308
309
310
311
312
313
314
315
316
317
318
319
320
321
322
323
324
325
326
327
328
329
330
331
332
333
334
335
336
337
338
339
340
341
342
343
344
345
346
347
348
349
350
351
352
353
354
355
356
357
358
359
360
361
362
363
364
365
366
367
368
369
370
371
372
373
374
375
376
377
378
379
380
381
382
383
384
385
386
387
388
389
390
391
392
393
394
395
396
397
398
399
400
401
402
403
404
405
406
407
408
409
410
411
412
413
414
415
416
417
418
419
420
421
422
423
424
425
426
427
428
429
430
431
432
433
434
435
436
437
438
439
440
441
442
443
444
445
446
447
448
449
449
450
451
452
453
454
455
456
457
458
459
460
461
462
463
464
465
466
467
468
469
470
471
472
473
474
475
476
477
478
479
480
481
482
483
484
485
486
487
488
489
490
491
492
493
494
495
496
497
498
499
500
501
502
503
504
505
506
507
508
509
510
511
512
513
514
515
516
517
518
519
520
521
522
523
524
525
526
527
528
529
530
531
532
533
534
535
536
537
538
539
540
541
542
543
544
545
546
547
548
549
550
551
552
553
554
555
556
557
558
559
559
560
561
562
563
564
565
566
567
568
569
569
570
571
572
573
574
575
576
577
578
579
579
580
581
582
583
584
585
586
587
588
589
589
590
591
592
593
594
595
596
597
598
599
599
600
601
602
603
604
605
606
607
608
609
609
610
611
612
613
614
615
616
617
618
619
619
620
621
622
623
624
625
626
627
628
629
629
630
631
632
633
634
635
636
637
638
639
639
640
641
642
643
644
645
646
647
648
649
649
650
651
652
653
654
655
656
657
658
659
659
660
661
662
663
664
665
666
667
668
669
669
670
671
672
673
674
675
676
677
678
679
679
680
681
682
683
684
685
686
687
688
689
689
690
691
692
693
694
695
696
697
698
699
699
700
701
702
703
704
705
706
707
708
709
709
710
711
712
713
714
715
716
717
718
719
719
720
721
722
723
724
725
726
727
728
729
729
730
731
732
733
734
735
736
737
738
739
739
740
741
742
743
744
745
746
747
748
749
749
750
751
752
753
754
755
756
757
758
759
759
760
761
762
763
764
765
766
767
768
769
769
770
771
772
773
774
775
776
777
778
779
779
780
781
782
783
784
785
786
787
788
789
789
790
791
792
793
794
795
796
797
798
799
799
800
801
802
803
804
805
806
807
808
809
809
810
811
812
813
814
815
816
817
818
819
819
820
821
822
823
824
825
826
827
828
829
829
830
831
832
833
834
835
836
837
838
839
839
840
841
842
843
844
845
846
847
848
849
849
850
851
852
853
854
855
856
857
858
859
859
860
861
862
863
864
865
866
867
868
869
869
870
871
872
873
874
875
876
877
878
879
879
880
881
882
883
884
885
886
887
888
889
889
890
891
892
893
894
895
896
897
898
899
899
900
901
902
903
904
905
906
907
908
909
909
910
911
912
913
914
915
916
917
918
919
919
920
921
922
923
924
925
926
927
928
929
929
930
931
932
933
934
935
936
937
938
939
939
940
941
942
943
944
945
946
947
948
949
949
950
951
952
953
954
955
956
957
958
959
959
960
961
962
963
964
965
966
967
968
969
969
970
971
972
973
974
975
976
977
978
979
979
980
981
982
983
984
985
986
987
988
989
989
990
991
992
993
994
995
996
997
998
999
1000
1001
1002
1003
1004
1005
1006
1007
1008
1009
1009
1010
1011
1012
1013
1014
1015
1016
1017
1018
1019
1019
1020
1021
1022
1023
1024
1025
1026
1027
1028
1029
1029
1030
1031
1032
1033
1034
1035
1036
1037
1038
1039
1039
1040
1041
1042
1043
1044
1045
1046
1047
1048
1049
1049
1050
1051
1052
1053
1054
1055
1056
1057
1058
1059
1059
1060
1061
1062
1063
1064
1065
1066
1067
1068
1069
1069
1070
1071
1072
1073
1074
1075
1076
1077
1078
1079
1079
1080
1081
1082
1083
1084
1085
1086
1087
1088
1089
1089
1090
1091
1092
1093
1094
1095
1096
1097
1098
1099
1099
1100
1101
1102
1103
1104
1105
1106
1107
1108
1109
1109
1110
1111
1112
1113
1114
1115
1116
1117
1118
1119
1119
1120
1121
1122
1123
1124
1125
1126
1127
1128
1129
1129
1130
1131
1132
1133
1134
1135
1136
1137
1138
1139
1139
1140
1141
1142
1143
1144
1145
1146
1147
1148
1149
1149
1150
1151
1152
1153
1154
1155
1156
1157
1158
1159
1159
1160
1161
1162
1163
1164
1165
1166
1167
1168
1169
1169
1170
1171
1172
1173
1174
1175
1176
1177
1178
1179
1179
1180
1181
1182
1183
1184
1185
1186
1187
1188
1189
1189
1190
1191
1192
1193
1194
1195
1196
1197
1198
1199
1199
1200
1201
1202
1203
1204
1205
1206
1207
1208
1209
1209
1210
1211
1212
1213
1214
1215
1216
1217
1218
1219
1219
1220
1221
1222
1223
1224
1225
1226
1227
1228
1229
1229
1230
1231
1232
1233
1234
1235
1236
1237
1238
1239
1239
1240
1241
1242
1243
1244
1245
1246
1247
1248
1249
1249
1250
1251
1252
1253
1254
1255
1256
1257
1258
1259
1259
1260
1261
1262
1263
1264
1265
1266
1267
1268
1269
1269
1270
1271
1272
1273
1274
1275
1276
1277
1278
1279
1279
1280
1281
1282
1283
1284
1285
1286
1287
1288
1289
1289
1290
1291
1292
1293
1294
1295
1296
1297
1298
1299
1299
1300
1301
1302
1303
1304
1305
1306
1307
1308
1309
1309
1310
1311
1312
1313
1314
1315
1316
1317
1318
1319
1319
1320
1321
1322
1323
1324
1325
1326
1327
1328
1329
1329
1330
1331
1332
1333
1334
1335
1336
1337
1338
1339
1339
1340
1341
1342
1343
1344
1345
1346
1347
1348
1349
1349
1350
1351
1352
1353
1354
1355
1356
1357
1358
1359
1359
1360
1361
1362
1363
1364
1365
1366
1367
1368
1369
1369
1370
1371
1372
1373
1374
1375
1376
1377
1378
1379
1379
1380
1381
1382
1383
1384
1385
1386
1387
1388
1389
1389
1390
1391
1392
1393
1394
1395
1396
1397
1398
1399
1399
1400
1401
1402
1403
1404
1405
1406
1407
1408
1409
1409
1410
1411
1412
1413
1414
1415
1416
1417
1418
1419
1419
1420
1421
1422
1423
1424
1425
1426
1427
1428
1429
1429
1430
1431
1432
1433
1434
1435
1436
1437
1438
1439
1439
1440
1441
1442
1443
1444
1445
1446
1447
1448
1449
1449
1450
1451
1452
1453
1454
1455
1456
1457
1458
1459
1459
1460
1461
1462
1463
1464
1465
1466
1467
1468
1469
1469
1470
1471
1472
1473
1474
1475
1476
1477
1478
1479
1479
1480
1481
1482
1483
1484
1485
1486
1487
1488
1489
1489
1490
1491
1492
1493
1494
1495
1496
1497
1498
1499
1499
1500
1501
1502
1503
1504
1505
1506
1507
1508
1509
1509
1510
1511
1512
1513
1514
1515
1516
1517
1518
1519
1519
1520
1521
1522
1523
1524
1525
1526
1527
1528
1529
1529
1530
1531
1532
1533
1534
1535
1536
1537
1538
1539
1539
1540
1541
1542
1543
1544
1545
1546
1547
1548
1549
1549
1550
1551
1552
1553
1554
1555
1556
1557
1558
1559
1559
1560
1561
1562
1563
1564
1565
1566
1567
1568
1569
1569
1570
1571
1572
1573
1574
1575
1576
1577
1578
1579
1579
1580
1581
1582
1583
1584
1585
1586
1587
1588
1589
1589
1590
1591
1592
1593
1594
1595
1596
1597
1598
1599
1599
1600
1601
1602
1603
1604
1605
1606
1607
1608
1609
1609
1610
1611
1612
1613
1614
1615
1616
1617
1618
1619
1619
1620
1621
1622
1623
1624
1625
1626
1627
1628
1629
1629
1630
1631
1632
1633
1634
1635
1636
1637
1638
1639
1639
1640
1641
1642
1643
1644
1645
1646
1647
1648
1649
1649
1650
1651
1652
1653
1654
1655
1656
1657
1658
1659
1659
1660
1661
1662
1663
1664
1665
1666
1667
1668
1669
1669
1670
1671
1672
1673
1674
1675
1676
1677
1678
1679
1679
1680
1681
1682
1683
1684
1685
1686
1687
1688
1689
1689
1690
1691
1692
1693
1694
1695
1696
1697
1698
1699
1699
1700
1701
1702
1703
1704
1705
1706
1707
1708
1709
1709
1710
1711
1712
1713
1714
1715
1716
1717
1718
1719
1719
1720
1721
1722
1723
1724
1725
1726
1727
1728
1729
1729
1730
1731
1732
1733
1734
1735
1736
1737
1738
1739
1739
1740
1741
1742
1743
1744
1745
1746
1747
1748
1749
1749
1750
1751
1752
1753
1754
1755
1756
1757
1758
1759
1759
1760
1761
1762
1763
1764
1765
1766
1767
1768
1769
1769
1770
1771
1772
1773
1774
1775
1776
1777
1778
1779
1779
1780
1781
1782
1783
1784
1785
1786
1787
1788
1789
1789
1790
1791
1792
1793
1794
1795
1796
1797
1798
1799
1799
1800
1801
1802
1803
1804
1805
1806
1807
1808
1809
1809
1810
1811
1812
1813
1814
1815
1816
1817
1818
1819
1819
1820
1821
1822
1823
1824
1825
1826
1827
1828
1829
1829
1830
1831
1832
1833
1834
1835
1836
1837
1838
1839
1839
1840
1841
1842
1843
1844
1845
1846
1847
1848
1849
1849
1850
1851
1852
1853
1854
1855
1856
1857
1858
1859
1859
1860
1861
1862
1863
1864
1865
1866
1867
1868
1869
1869
1870
1871
1872
1873
1874
1875
1876
1877
1878
1879
1879
1880
1881
1882
1883
1884
1885
1886
1887
1888
1889
1889
1890
1891
1892
1893
1894
1895
1896
1897
1898
1899
1899
1900
1901
1902
1903
1904
1905
1906
1907
1908
1909
1909
1910
1911
1912
1913
1914
1915
1916
1917
1918
1919
1919
1920
1921
1922
1923
1924
1925
1926
1927
1928
1929
1929
1930
1931
1932
1933
1934
1935
1936
1937
1938
1939
1939
1940
1941
1942
1943
1944
1945
1946
1947
1948
1949
1949
1950
1951
1

PLATE FORTY-SEVEN
EAST BURKE MOUNTAIN
LAST STERLING FISH
MID-DAIRY

WATKINS, ROBERT HENRY, INVENTOR OF WATKINS' JELLS
OF MUSKETT, HENRY, INVENTOR OF WATKINS' JELLS
OF CANNING, WATKINS, ROBERT HENRY, INVENTOR OF

838 *John G. Hart*

For the first time, the results of the 1990 census were released to the public.

ALL-TELE ANALYSIS To be performed
by **ALLTELE** before **CRITICAL**

卷之三

卷之三

TABLE I SPECTRAL PROPERTIES OF THE PLANET		TABLE II SPECTRAL PROPERTIES OF THE PLANET	
1.000	0.972	1.000	0.98
0.90	0.870	0.900	0.867
0.80	0.760	0.800	0.759
0.70	0.660	0.700	0.659
0.60	0.560	0.600	0.560
0.50	0.460	0.500	0.460
0.40	0.360	0.400	0.360
0.30	0.260	0.300	0.260
0.20	0.160	0.200	0.160
0.10	0.060	0.100	0.060
0.00	0.000	0.000	0.000

190 2.75 670.6 NIA = 9
191 1.95 670.6 NIA = 9
192 1.95 670.6 NIA = 9
193 1.95 670.6 NIA = 9
194 1.95 670.6 NIA = 9
195 1.95 670.6 NIA = 9
196 1.95 670.6 NIA = 9
197 1.95 670.6 NIA = 9
198 1.95 670.6 NIA = 9
199 1.95 670.6 NIA = 9
200 1.95 670.6 NIA = 9

وَمِنْ أَعْلَى الْجَنَاحَيْنِ لَهُمْ لِلْأَذْكُورِ مُلْكٌ وَّلَهُمْ لِلْأَنْوَارُ
لَهُمْ لِلْأَنْوَارُ لَهُمْ مَا شَاءُوا وَلَهُمْ هُنَّ الْمُنْتَصِرُونَ

فَلَمَّا دَرَأَهُمُ الظَّاءُ وَأَنْتَ بِالْأَنْوَارِ

| Population | 1911 | 1912 | 1913 | 1914 | 1915 | 1916 | 1917 | 1918 | 1919 | 1920 | 1921 | 1922 | 1923 | 1924 | 1925 | 1926 | 1927 | 1928 | 1929 | 1930 | 1931 | 1932 | 1933 | 1934 | 1935 | 1936 | 1937 | 1938 | 1939 | 1940 | 1941 | 1942 | 1943 | 1944 | 1945 | 1946 | |

SUSTAINING CONDITIONS

PLAN I	INITIAL DEBT \$89,40 Bd. Co. C. C.	SPLITUP CAPITAL		INITIAL DEBT \$44 \$99,40 Bd. Co. C. C.	
		RATIO OF SUSTAINING CONDITIONS	INITIAL DEBT \$14,00 Bd. Co. C. C.	RATIO OF SUSTAINING CONDITIONS	INITIAL DEBT \$44 \$14,00 Bd. Co. C. C.
1.04	291.66	4.87	12.62	1.07	11.90
0.75	306.01	7.51	17.01	1.00	11.70
0.50	307.17	1.57	11.43	9.41	7.50
0.25	307.66	0.6	10.94	5.71	9.02

SUSTAINING CONDITIONS

Sept 20 1939

BRUNSWICK AND NEW YORK RAILROAD COMPANY

Planned by the National Park Service
as part of the 1966-1968
eastern facilities program.
Approved by the
Senate.

CANADIAN PARLIAMENTARY INVESTIGATION COMMITTEE ON
FEDERAL TAXES AND FEDERAL TAXATION AND THE
WALL STREET CRASH OF 1929

ANALYSIS OF THE SPANISH INFLUENCE

A vertical column of six small, dark circular dots, likely used as a decorative element or a placeholder.

卷之三

1900 2000 1900 1900 1900
1900 1900 1900 1900 1900

Group	Mean	SD	Median	Range	N
Control	1.00	0.00	1.00	0.00-1.00	10
Group A	0.98	0.02	1.00	0.95-1.00	10
Group B	0.98	0.02	1.00	0.95-1.00	10
Group C	0.98	0.02	1.00	0.95-1.00	10
Group D	0.98	0.02	1.00	0.95-1.00	10
Group E	0.98	0.02	1.00	0.95-1.00	10
Group F	0.98	0.02	1.00	0.95-1.00	10
Group G	0.98	0.02	1.00	0.95-1.00	10
Group H	0.98	0.02	1.00	0.95-1.00	10
Group I	0.98	0.02	1.00	0.95-1.00	10
Group J	0.98	0.02	1.00	0.95-1.00	10
Group K	0.98	0.02	1.00	0.95-1.00	10
Group L	0.98	0.02	1.00	0.95-1.00	10
Group M	0.98	0.02	1.00	0.95-1.00	10
Group N	0.98	0.02	1.00	0.95-1.00	10
Group O	0.98	0.02	1.00	0.95-1.00	10
Group P	0.98	0.02	1.00	0.95-1.00	10
Group Q	0.98	0.02	1.00	0.95-1.00	10
Group R	0.98	0.02	1.00	0.95-1.00	10
Group S	0.98	0.02	1.00	0.95-1.00	10
Group T	0.98	0.02	1.00	0.95-1.00	10
Group U	0.98	0.02	1.00	0.95-1.00	10
Group V	0.98	0.02	1.00	0.95-1.00	10
Group W	0.98	0.02	1.00	0.95-1.00	10
Group X	0.98	0.02	1.00	0.95-1.00	10
Group Y	0.98	0.02	1.00	0.95-1.00	10
Group Z	0.98	0.02	1.00	0.95-1.00	10

卷之三

Burr 22-00-37

وَالْمُؤْمِنُونَ هُمُ الْأَوَّلُونَ مَنْ يَرِدُ إِلَيْهِمْ رَبُّهُمْ وَمَا
يَرِدُ إِلَيْهِمْ مِنْ أَنْذِلَ اللَّهُ مِنْ آنَىٰ

卷之三

卷之三

1976-1977
1977-1978
1978-1979
1979-1980
1980-1981
1981-1982
1982-1983
1983-1984
1984-1985
1985-1986
1986-1987
1987-1988
1988-1989
1989-1990
1990-1991
1991-1992
1992-1993
1993-1994
1994-1995
1995-1996
1996-1997
1997-1998
1998-1999
1999-2000
2000-2001
2001-2002
2002-2003
2003-2004
2004-2005
2005-2006
2006-2007
2007-2008
2008-2009
2009-2010
2010-2011
2011-2012
2012-2013
2013-2014
2014-2015
2015-2016
2016-2017
2017-2018
2018-2019
2019-2020
2020-2021
2021-2022
2022-2023
2023-2024
2024-2025
2025-2026
2026-2027
2027-2028
2028-2029
2029-2030
2030-2031
2031-2032
2032-2033
2033-2034
2034-2035
2035-2036
2036-2037
2037-2038
2038-2039
2039-2040
2040-2041
2041-2042
2042-2043
2043-2044
2044-2045
2045-2046
2046-2047
2047-2048
2048-2049
2049-2050
2050-2051
2051-2052
2052-2053
2053-2054
2054-2055
2055-2056
2056-2057
2057-2058
2058-2059
2059-2060
2060-2061
2061-2062
2062-2063
2063-2064
2064-2065
2065-2066
2066-2067
2067-2068
2068-2069
2069-2070
2070-2071
2071-2072
2072-2073
2073-2074
2074-2075
2075-2076
2076-2077
2077-2078
2078-2079
2079-2080
2080-2081
2081-2082
2082-2083
2083-2084
2084-2085
2085-2086
2086-2087
2087-2088
2088-2089
2089-2090
2090-2091
2091-2092
2092-2093
2093-2094
2094-2095
2095-2096
2096-2097
2097-2098
2098-2099
2099-20100

THE HISTORY OF THE CHINESE IN AMERICA

Saint 24 oo 29

卷之三

the same name, and the same date, but it
was written in a different hand.

and the *lungs* were found to be healthy and nothing was seen which could be regarded as pathological.

卷之三

卷之三

卷之三

卷之三

卷之三

卷之三

三三

333

卷之三

卷之三

卷之三

1995 26 00

卷之三

Sixty 27 or 29

卷之三

Car	Year	Condition	2000-2004 Avg.	2005-2009 Avg.	2010-2014 Avg.	2015-2019 Avg.
Cars	95%	As-is	\$10,000	\$10,000	\$10,000	\$10,000
Cars	6%	As-is	\$10,000	\$10,000	\$10,000	\$10,000
1-5 years	As-is	\$10,000	\$10,000	\$10,000	\$10,000	
6-10 years	As-is	\$10,000	\$10,000	\$10,000	\$10,000	
11-15 years	As-is	\$10,000	\$10,000	\$10,000	\$10,000	
16-20 years	As-is	\$10,000	\$10,000	\$10,000	\$10,000	
21+ years	As-is	\$10,000	\$10,000	\$10,000	\$10,000	

APPENDIX D
REFERENCES

REFERENCES

1. University of the State of New York, Geology of New York, Education Leaflet 20, 1966.
2. Broughton, John G. and others, "Geologic Map of New York - Lower Hudson Sheet," New York State Museum and Science Service, Map and Chart Series No. 15, 1970.
3. Soil Conservation Service, Soil Interpretations Inventory Analysis and Erosion Control - Orange County, New York, U.S. Dept. of Agriculture, January 1972.
4. Chow, Ven Te, Handbook of Applied Hydrology, McGraw - Hill Book Company, New York, 1964.
5. Chow, Ven Te, Open Channel Hydraulics, McGraw - Hill Book Company, New York, First Edition, 1959.
6. HMR 33, "Seasonal Variations of Probable Maximum Precipitation, East of the 105th Meridian for Areas 10 to 1000 Square Miles and Durations of 6 to 48 Hours," (1956).
7. King, Horace Williams and Brater, Ernest F., Handbook of Hydraulics, Fifth Edition, McGraw - Hill Book Company, New York, 1963.
8. Soil Conservation Service, "National Engineering Handbook - Section 4, Hydrology," U.S. Department of Agriculture, 1964.
9. Soil Conservation Service, "National Engineering Handbook - Section 5, Hydraulics," U.S. Department of Agriculture.
10. U.S. Army, Hydrological Engineering Center, "Flood Hydrograph Package (HEC-1), Dam Safety Investigations, Users Manual," Corps of Engineers, Davis, California, September 1978.
11. U.S. Army, "Inventory of United States Dams," Corps of Engineers, 9 September 1978.
12. U.S. Army, Office of the Chief of Engineers, "Appendix D, Recommended Guidelines for Safety Inspection of Dams," National Program of Inspection of Dams, Volume 1, Corps of Engineers, Washington, D.C., May 1975.
13. George, Thomas S. and Taylor, Robert S., Hydrologic Flood Routing Model For Lower Hudson River Basin, Water Resources Engineers, Inc., 8001 Forbes Place, Suite 312, Springfield, Virginia, January 1977.

14. U.S. Army, Office of the Chief of Engineers, Engineering Circular EC-1110-2-163 (Draft Engineering Manual), "Spillway and Freeboard Requirements for Dams, Appendix C, Hydrometeorological Criteria and Hyetograph Estimates," (August 1975).
15. U.S. Army, Office of the Chief of Engineers, Engineering Circular EC-1110-2-188, "Engineering and Design, National Program of Inspection of Non-Federal Dams," Corps of Engineers, Washington, D.C., 30 December 1977.
16. U.S. Army, Office of the Chief of Engineers, Engineer Technical Letter No. ETL 1110-2-234, "Engineering and Design, National Program of Inspection of Non-Federal Dams, Review of Spillway Adequacy," Corps of Engineers, Washington, D.C., 10 May 1978.

APPENDIX E

DRAWINGS

CONTENTS


Location Plan

Watershed Map


Plate 1: Field Sketch

Plate 2: Plan View

Plate 3: Details

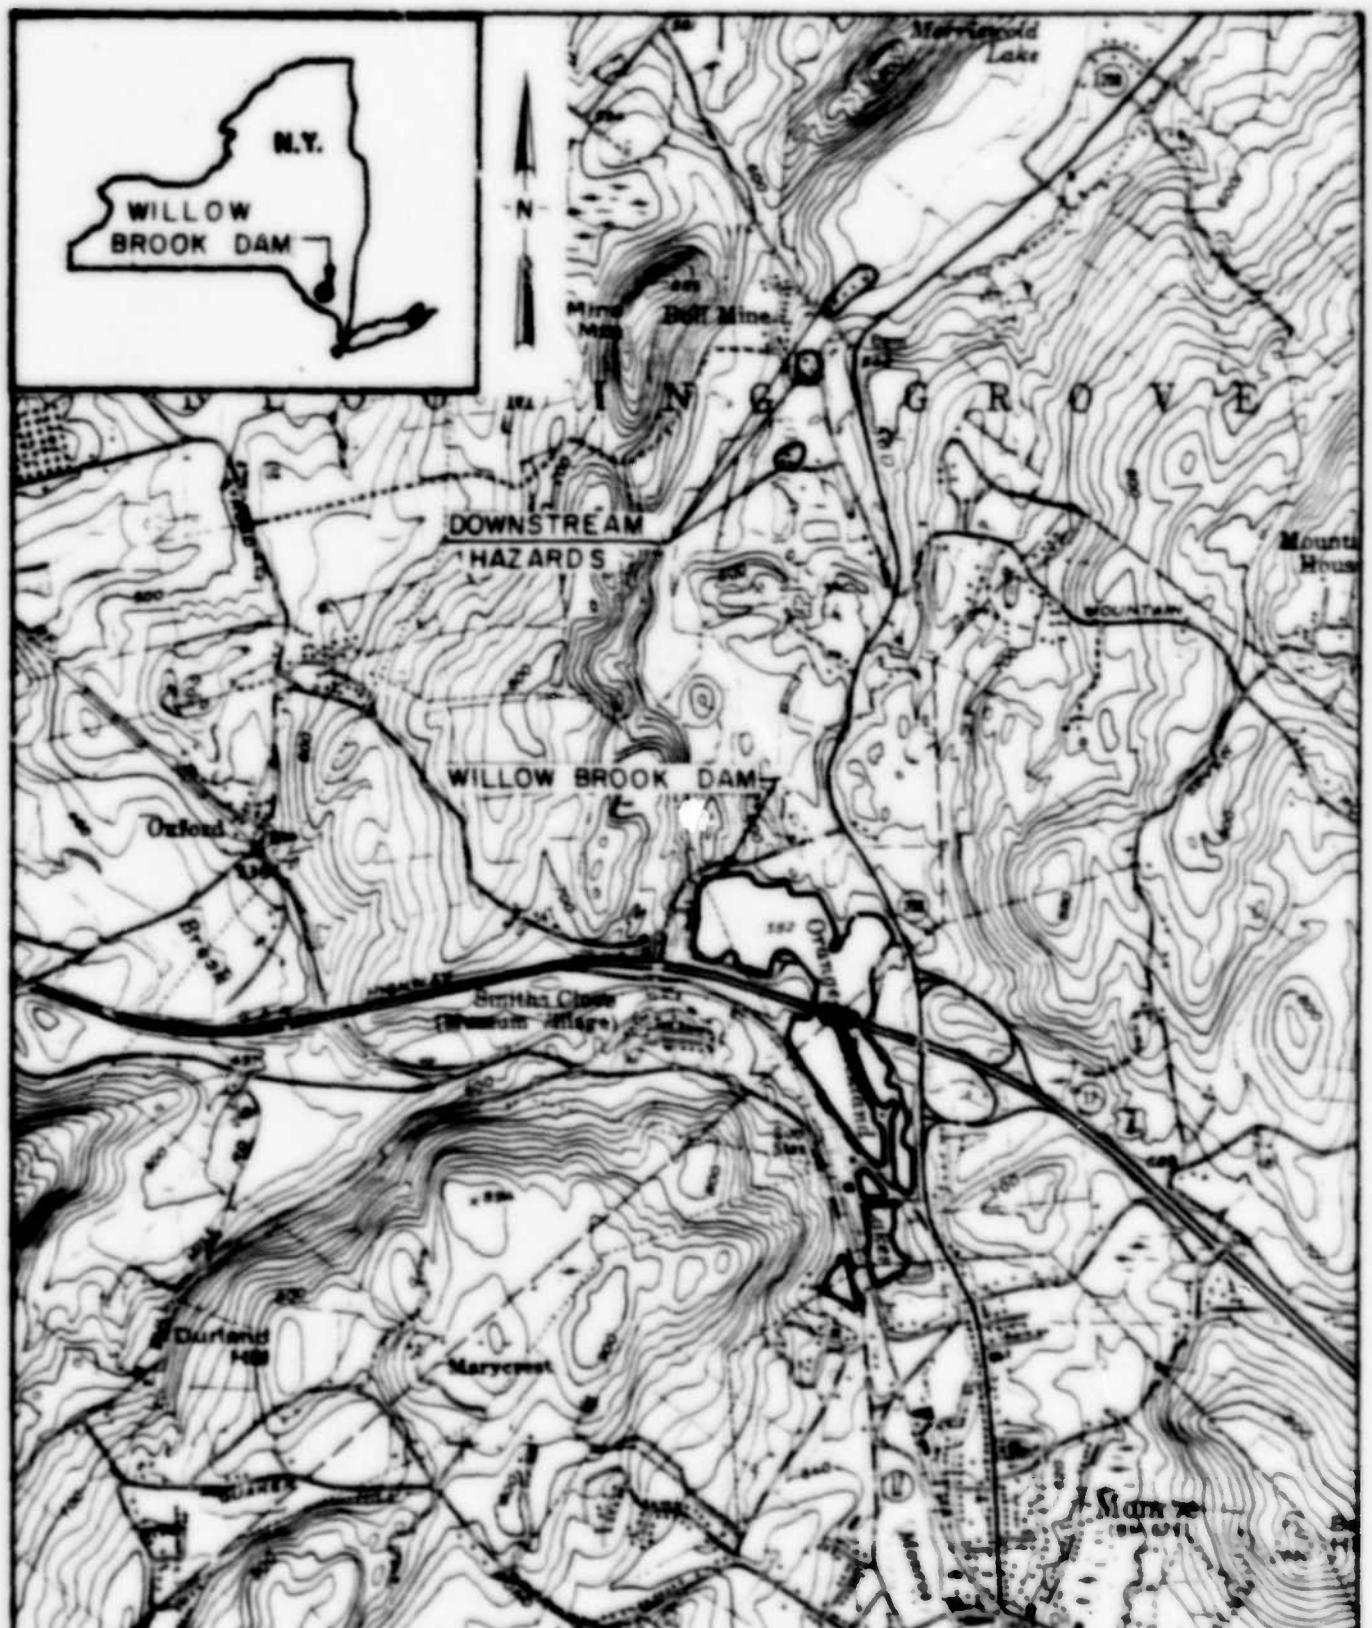


SCALE 1:24000

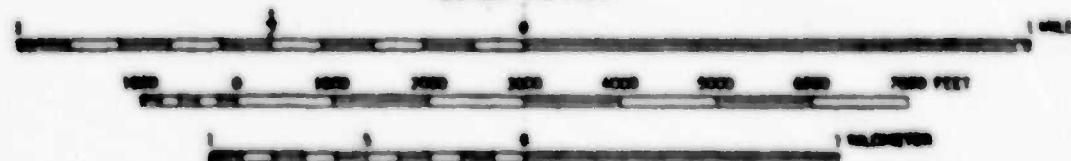

REFERENCES
U.S.G.S. 7.5' MONROE, N.Y.
QUADRANGLE 1957

LOCATION PLAN
WILLOW BROOK DAM

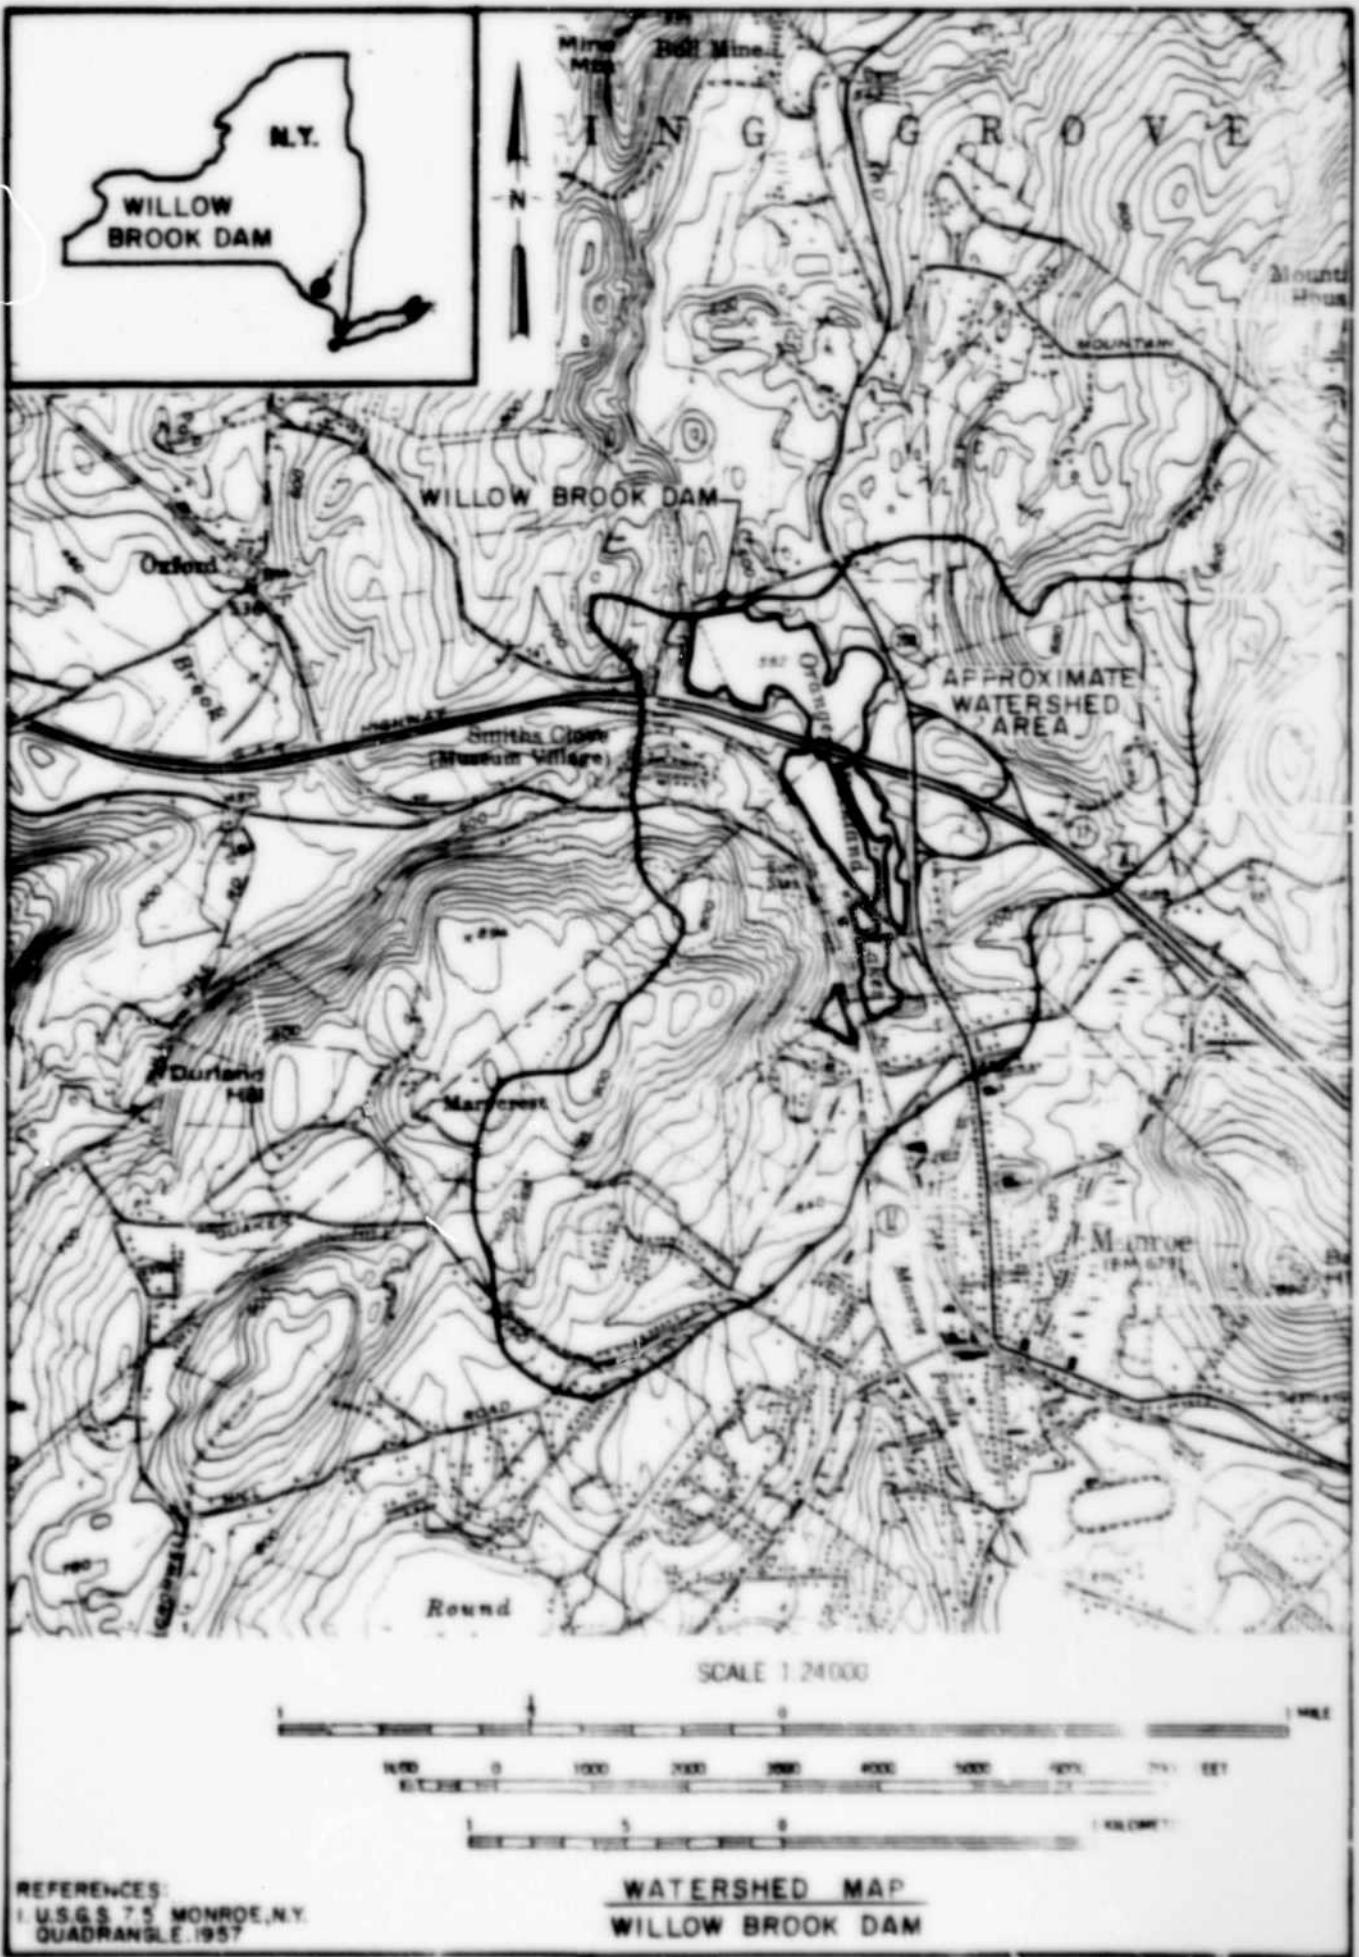

~ Reserve ~




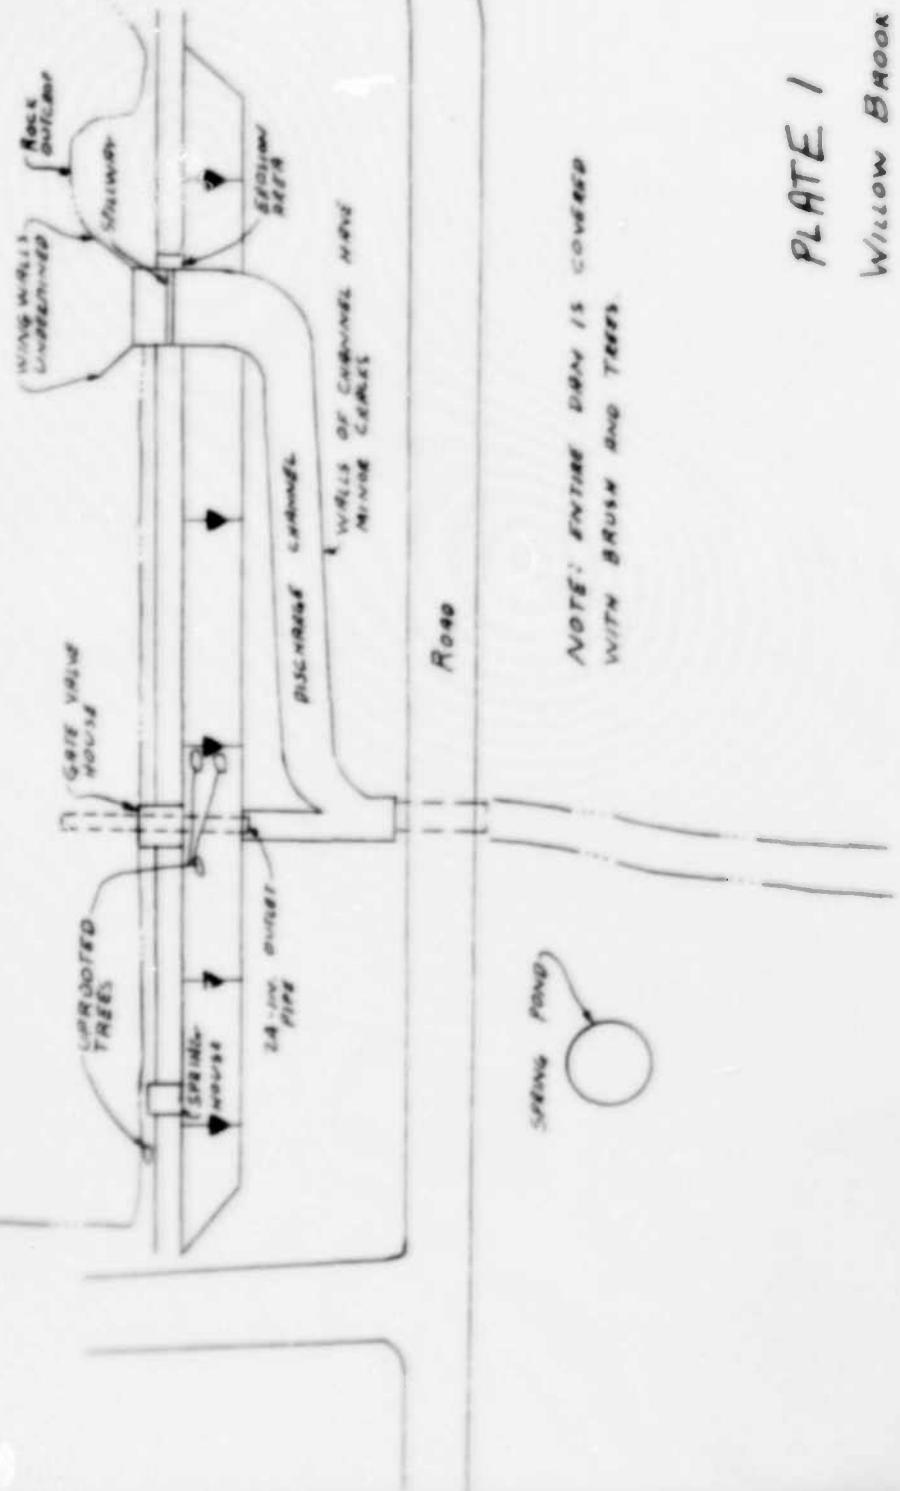


PLATE I

Willow Brook Dam
Field System

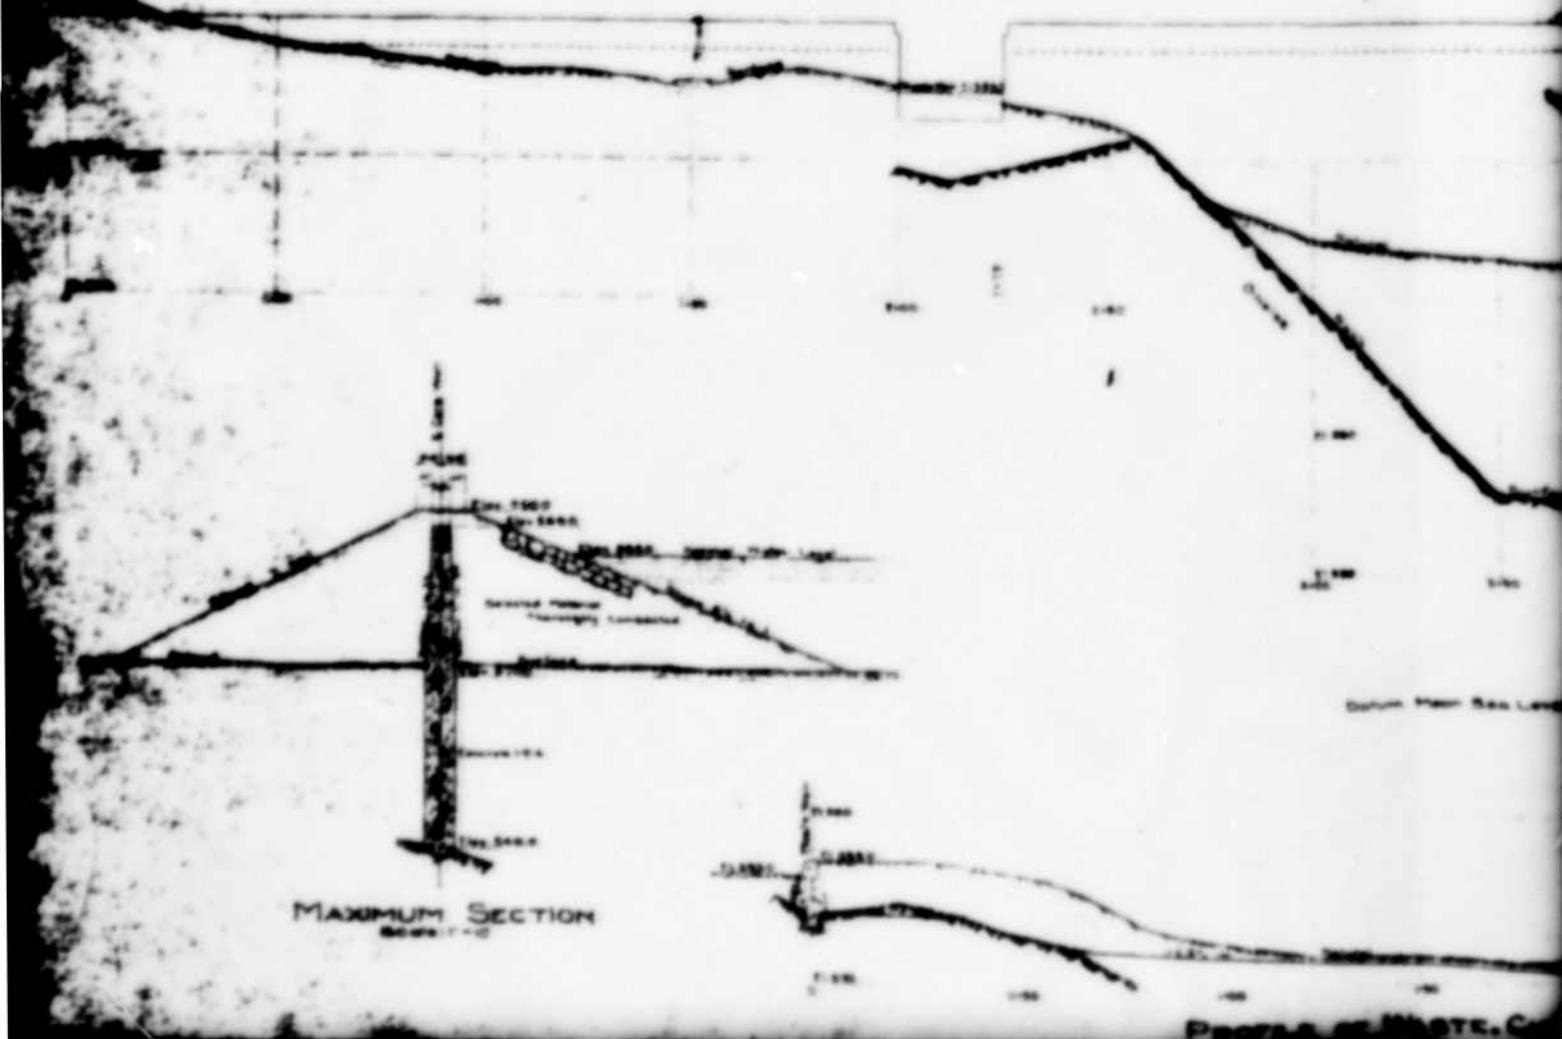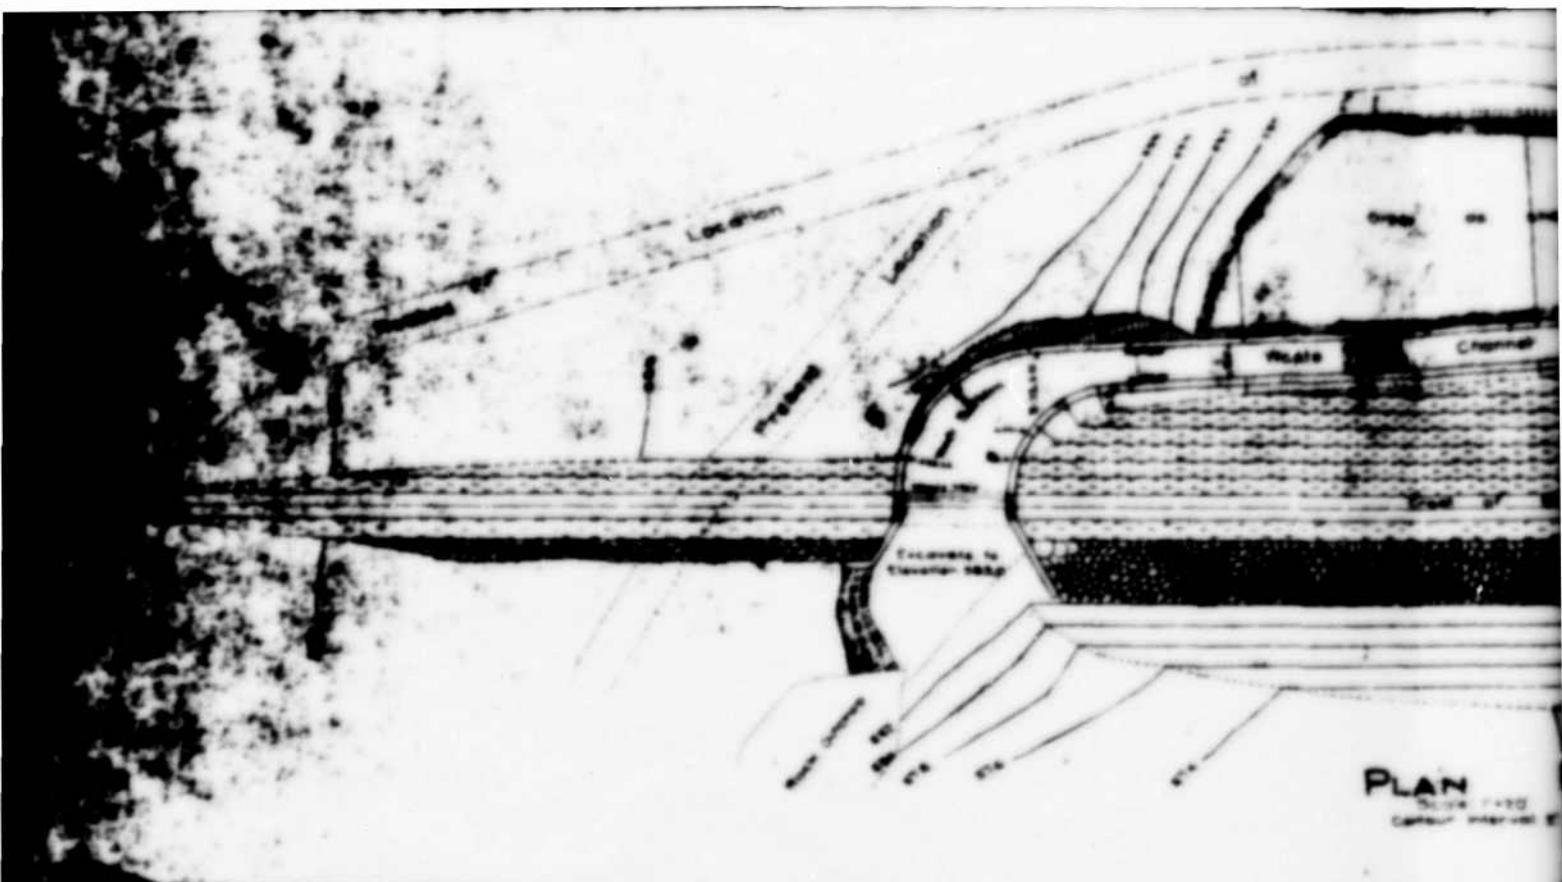

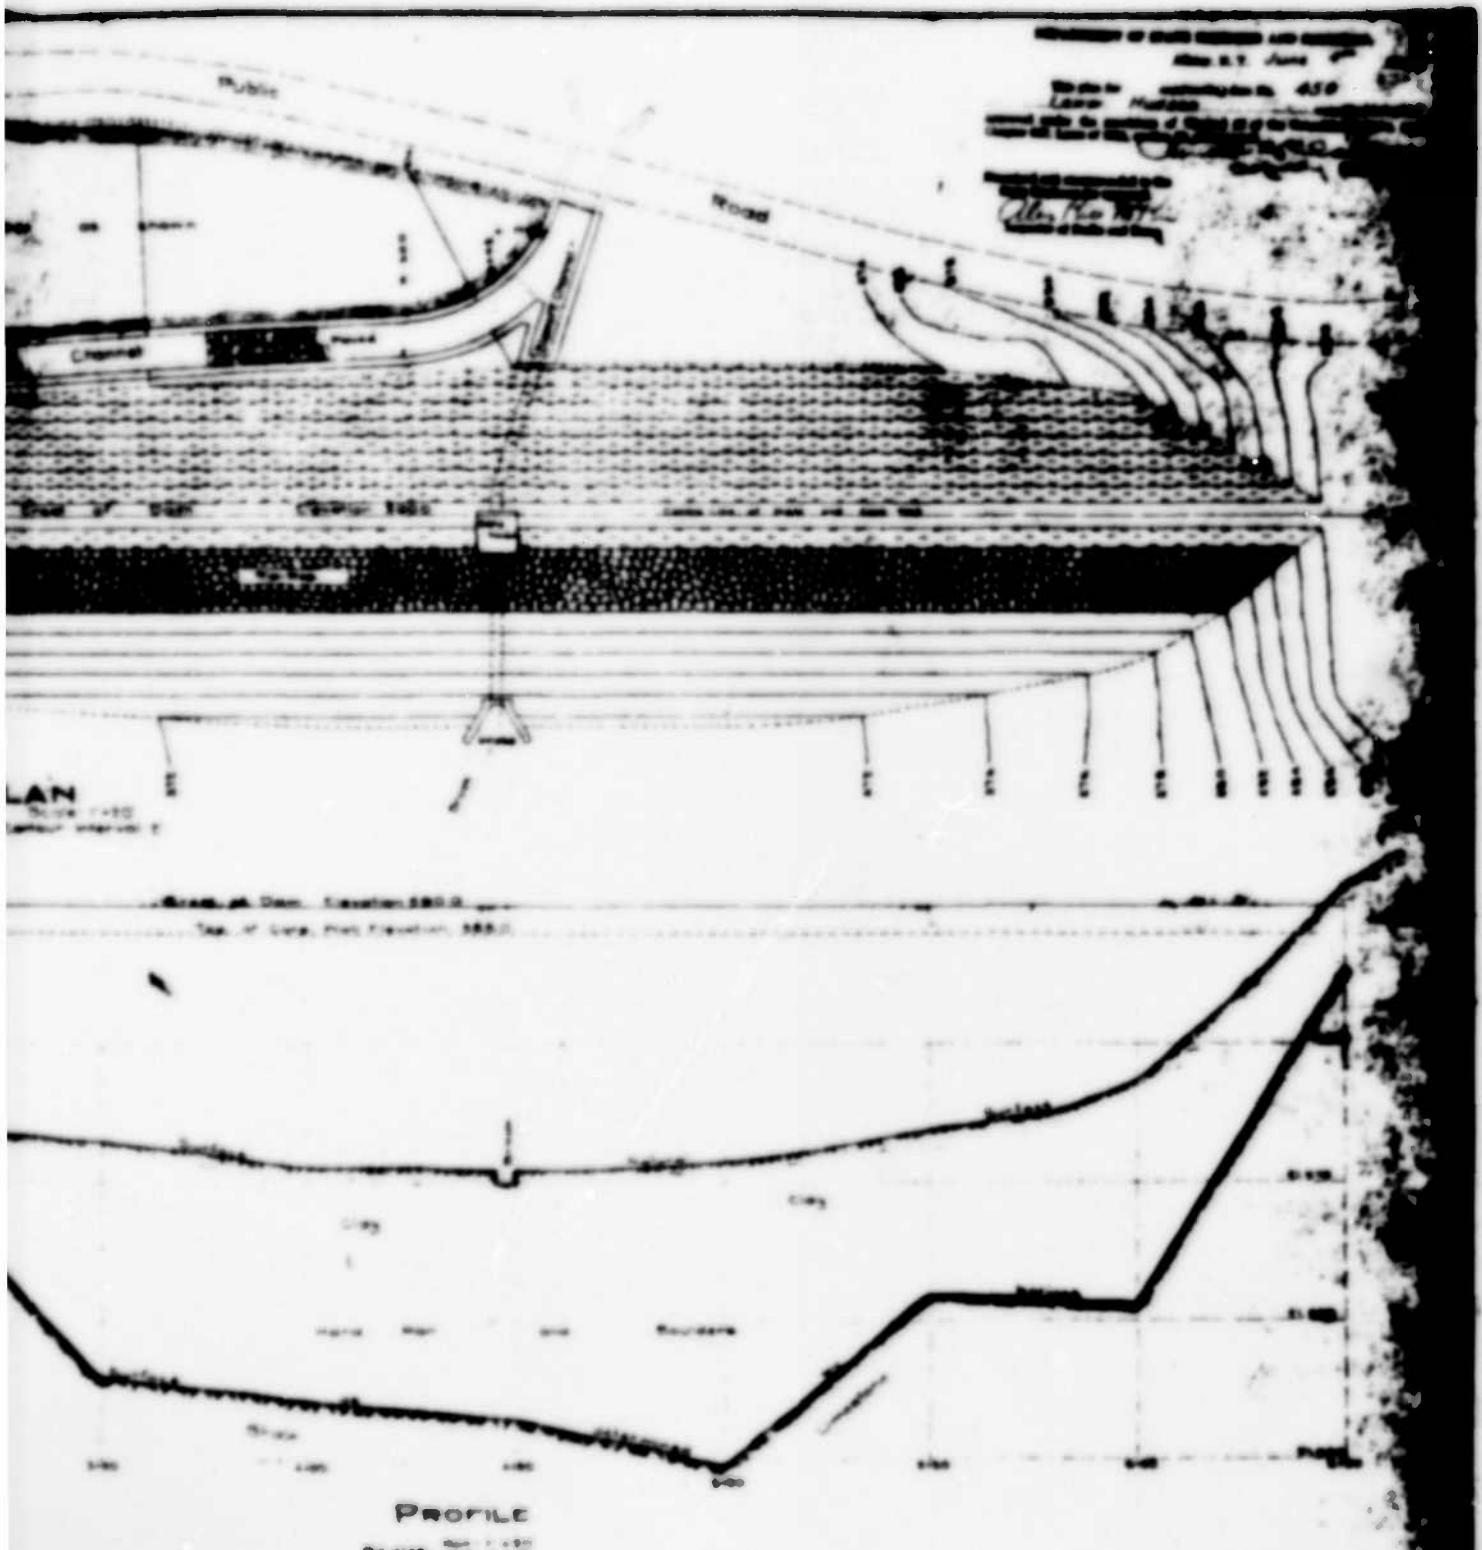

ORANGE & ROCKLAND ELECTRIC CO.

PLANS FOR DAM

AT


MONROE, N.Y.


November 27, 1923

Approved *P. Morris*

PLATE 2

450

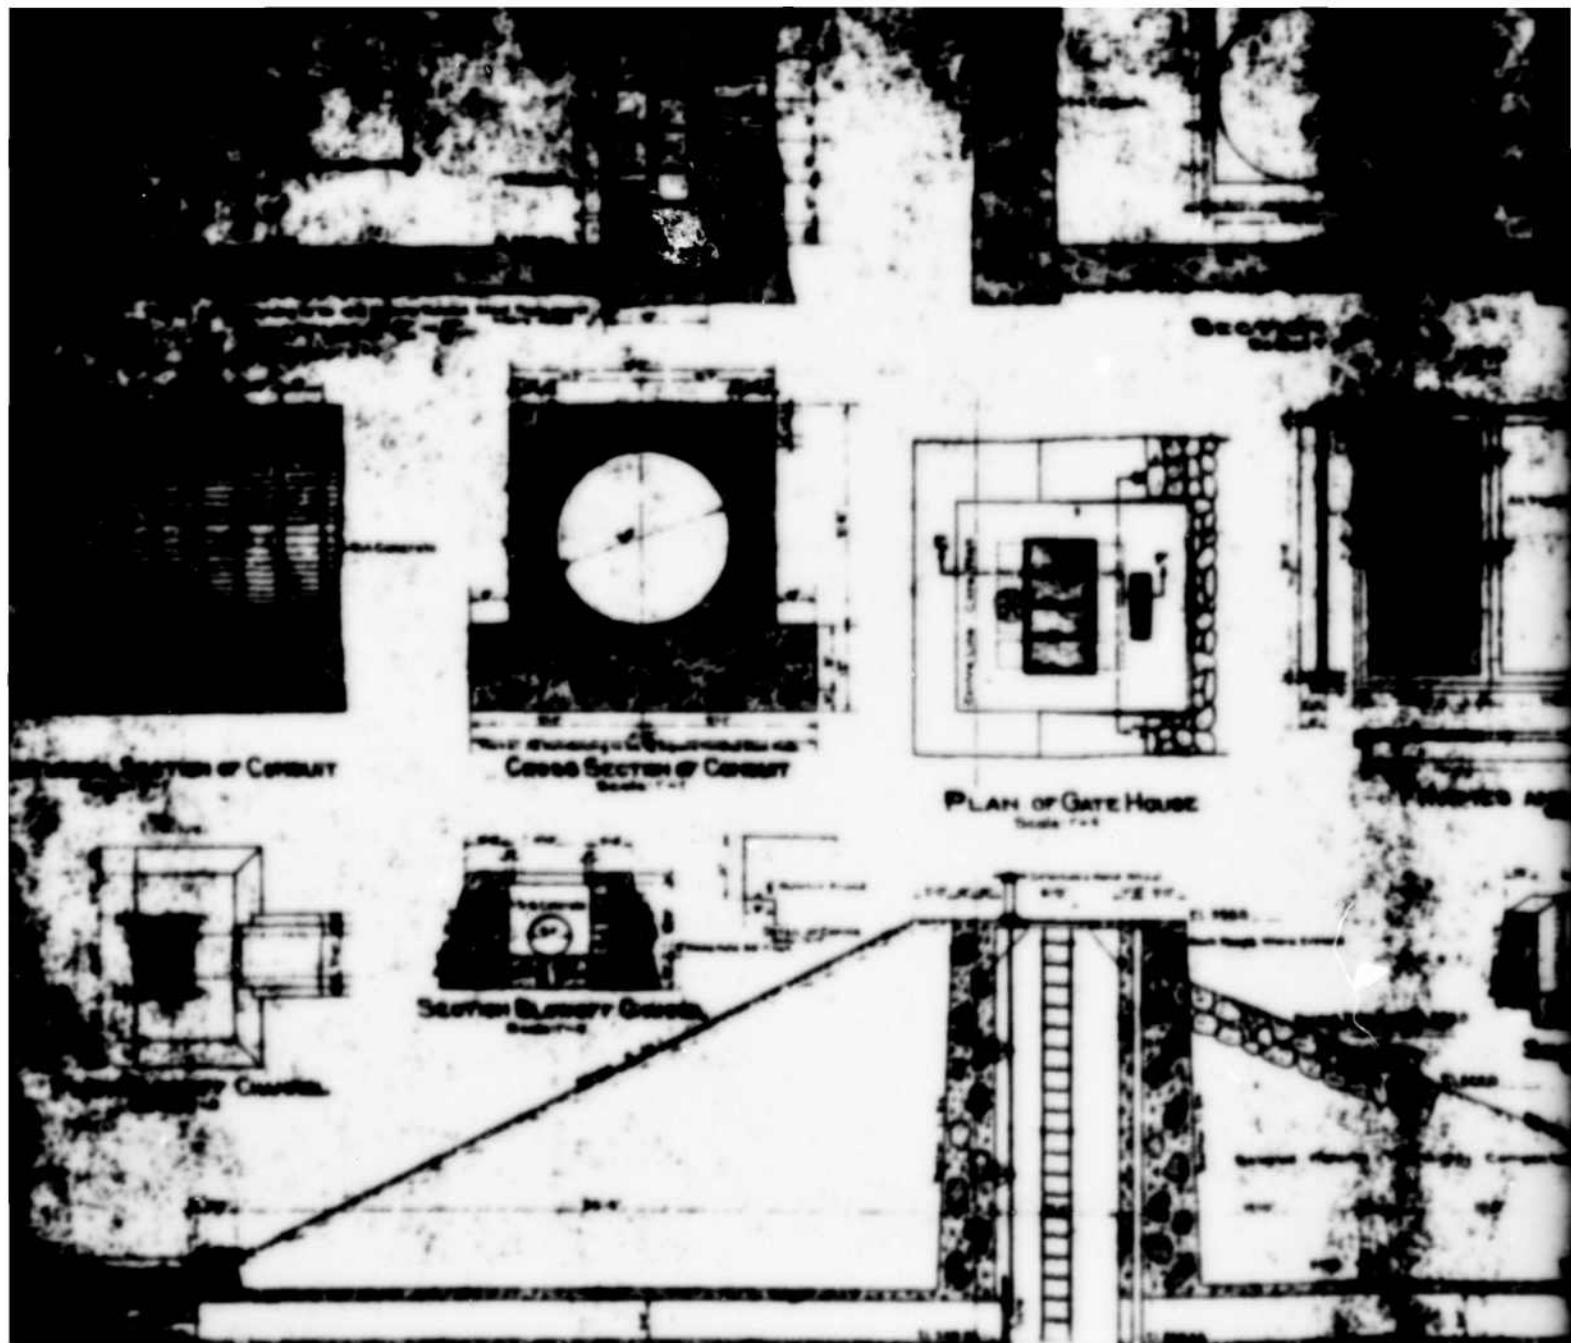

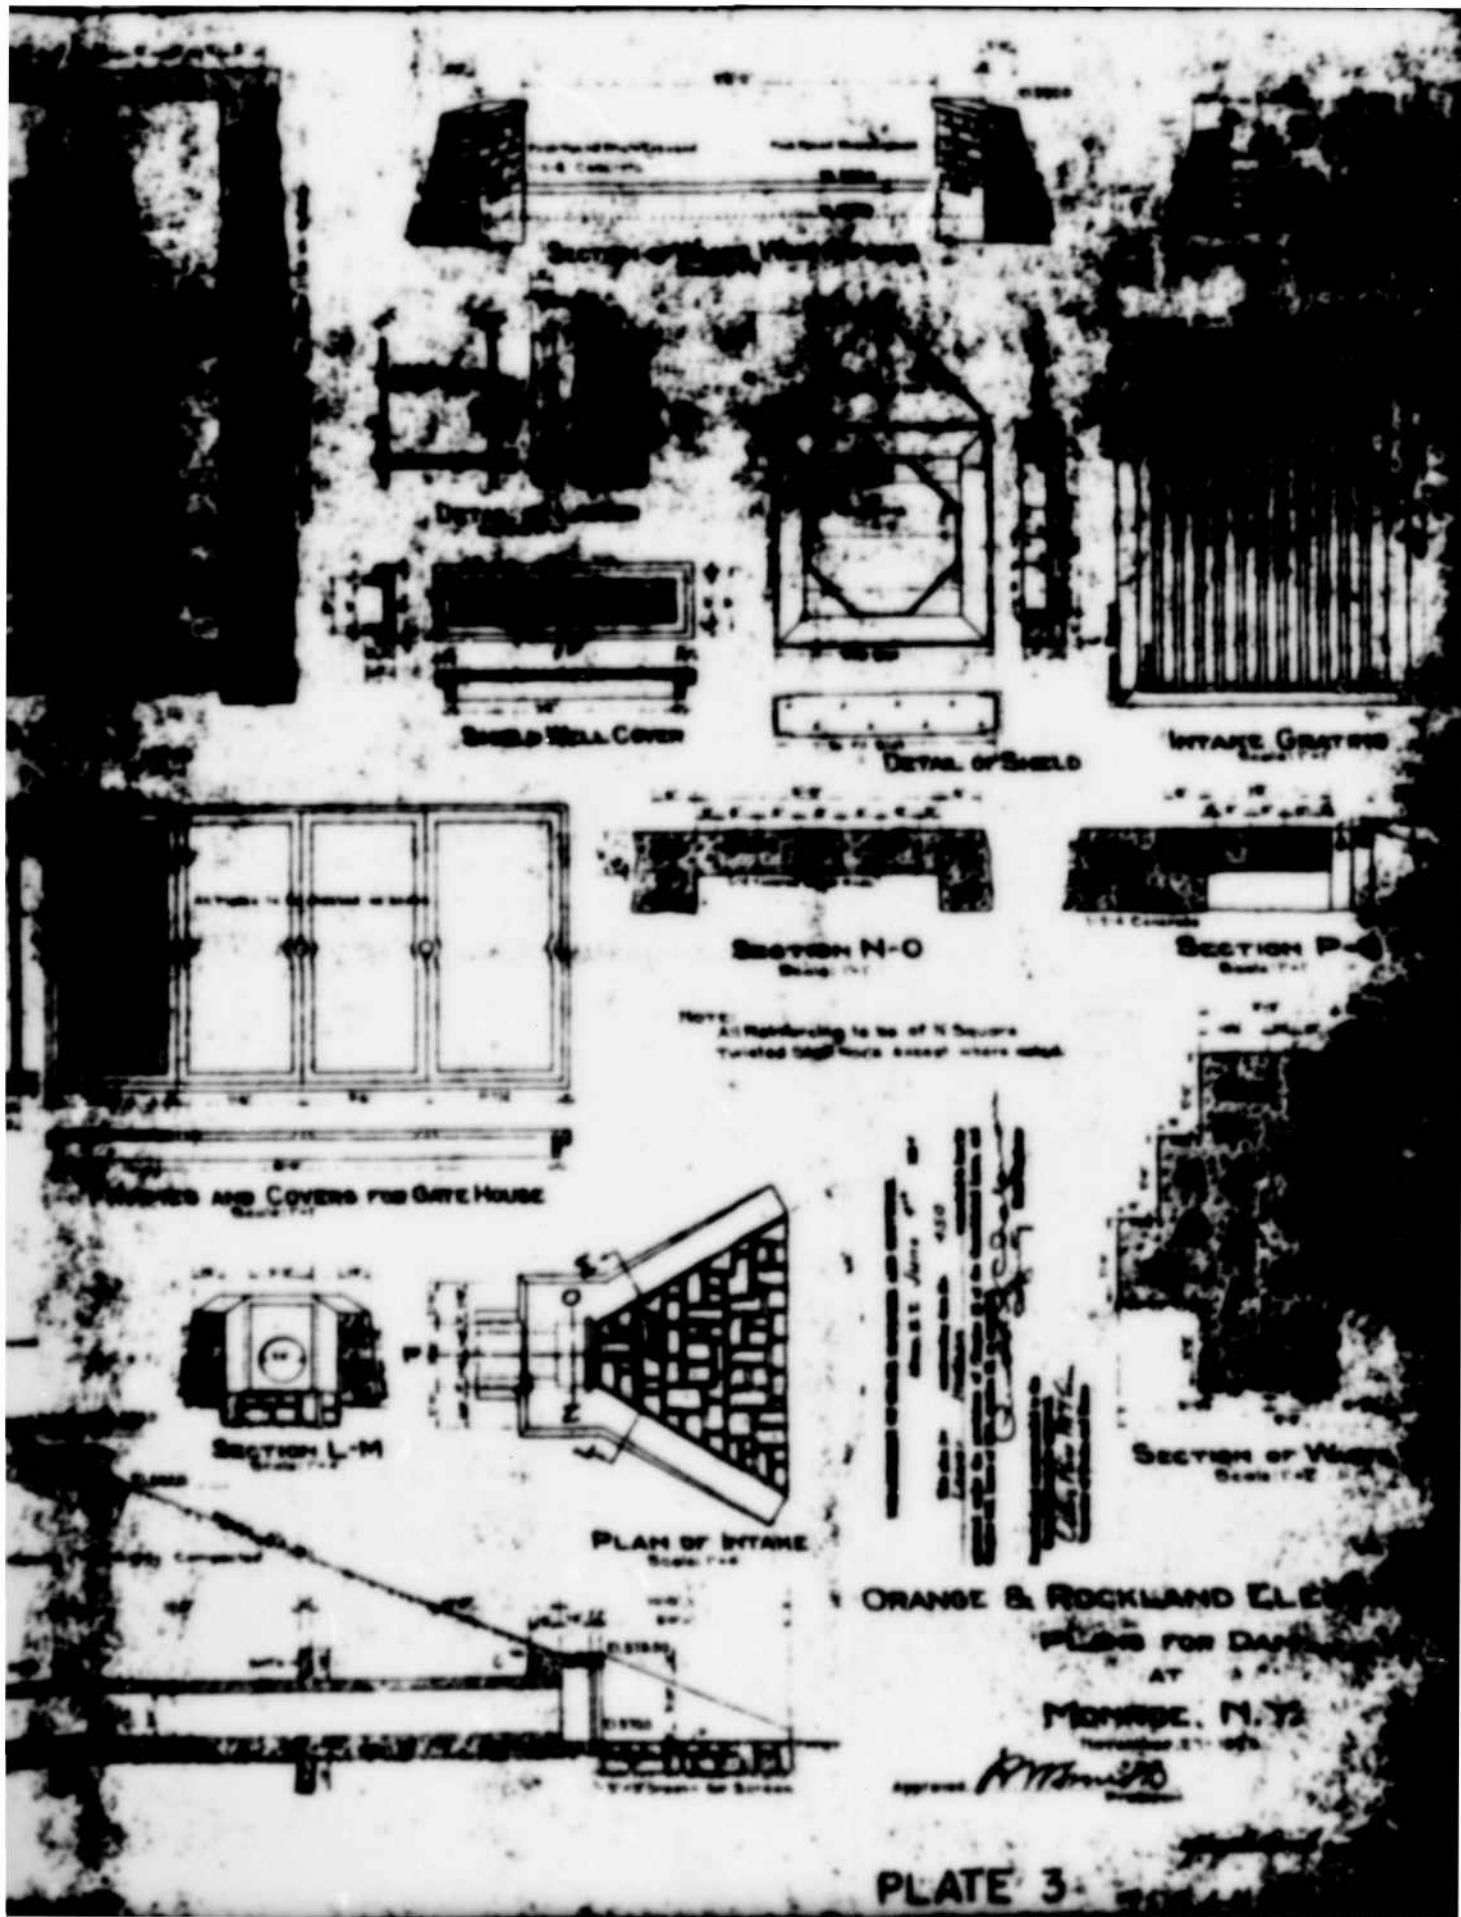

APPENDIX F
BACKGROUND DOCUMENTS

DEC DAM INSPECTION REPORT

51

36

24

450

157077

23

1

RB

CTY

YR. AP.

DAM NO.

INS. DATE

USE

TYPE

AS BUILT INSPECTION Location of Spillway
and outlet Elevations Size of Spillway
and outlet Geometry of
Non-overflow sectionGENERAL CONDITION OF NON-OVERFLOW SECTION Settlement Cracks Deflections Joints Surface of
Concrete Leakage Undermining Settlement of
Embankment Crest of Dam Downstream
Slope *Frees* Upstream
Slope Toe of
SlopeGENERAL CONDITION OF SPILLWAY AND OUTLET WORKS Auxiliary
Spillway Service or
Concrete Spillway Stilling
Basin Joints Surface of
Concrete Spillway
Toe Mechanical
Equipment Plunge
Pool Drain Maintenance Hazard Class Evaluation InspectorCOMMENTS:

July 27, 1954

MEMORANDUM

RE: Telephone conversation with Peter Bush, Monroe Village Engineer regarding description of the underground caverns under the large Orange and Rockland lake.

When we were excavating for a foundation for the dam, we went down to a depth of over 50' before we found solid rock and near the bottom there were two streams of water running in the footing excavation.

Mr. Bush made numerous tests to determine if one cavern had any connection with the other cavern and tests proved that they were entirely separate. We planned and constructed separate outlets from these caverns so that the outlet from one cavern was piped across the highway and through a concrete box where a gate valve was placed, and the pipe continued to the spring, around which a wall was built at that same time.

The other cavern was securely sealed and a pipe and concrete masonry extended to the top of the dam so that a deep well pump could be connected to that source, which was tested at that time and found to be good for drinking purposes. The capacity of this cavern is 20 gallons per minute continuous flow.

R. W. Smith

March 25, 1953

Clarke and Spaulding
145 West 32nd Street
New York 1, N. Y.

Attention: Mr. Charles Macdonald

Dear Mr. Macdonald:

Since my return from the south, I have noticed a raft out in the middle of our lake, with some canvas wind protectors around it and upon inquiry I am informed that your men are drilling a test hole in our lake, to ascertain underwater conditions and that the hole is down some sixt - id feet as of last week-end.

We are quite concerned with what you are doing because of conditions that exist of which we believe you are not aware and they are as follows:

Our lakes, as you may know, were built originally for power plant purposes. It was necessary for us to purchase several farms in order to obtain possession of the valley where the lake is located. Our engineers, Knight, Bush & Thompson, drilled a number of test holes across the valley to ascertain the underground conditions before making their drawings for the construction of the dam, which was afterward built to impound the water of the stream going down through the valley.

In order to have a tight dam it was necessary for us to first remove the earth across the valley and then remove the limestone to a depth in the lowest places of more than 50' in order to reach the granite rock formation upon which to start the foundation of the dam.

Of course we knew that there was a large spring bubbling over with nearly 400 gallons of water per minute below the proposed site of the dam and when we had excavated to the hard rock, we found two streams of underground water, each of which had no relation to the stream passing through the meadow. One of these streams was sealed off tight and

Mr. Charles MacDonald

-2-

March 25, 1953

connected with the stand pipe that goes up through the core of our dam. The measurement of that stream, together with the time it took to raise the water level in our stand pipe until it became stationary, indicated that there was an underground reservoir holding sufficient water for a small village.

The other stream of water could not be trapped into the lake and that stream is still running and coming to the surface in the above mentioned spring. This spring was temporarily dry when our pumps were operating to keep the excavation dewatered and we thought it a good time to clean the muck out of the spring and build a wall around it. This we did and we were surprised to find some mastodon bones, including some teeth, in the muck of the spring, which indicated that that animal went there for a drink of water thousands of years ago, became mired in the water and died.

We are telling you of this reservoir and spring because of the remote possibility that your drilling through the bed of our lake might provide a passage of water from our lake into the underground reservoir or into the spring below the lake, in which case we might lose the lake.

Yours very truly,

ORLAND L. ROCKLAND ELECTRIC COMPANY

R. W. Smith,
President

R.S/bhz

cc: Mr. J. S. Bixby, District Engineer,
New York State Highway Dept.

L. D. HEDRICK, Division Engineer

STATE OF NEW YORK
DEPARTMENT OF STATE ENGINEER AND SURVEYOR
EASTERN DIVISION
JOURNAL BLDG.
ALBANY

SUBJECT:

Dam No. 450, L.H.,
Monroe.

July 23, 1926.

return

Hon. Roy G. Finch,
State Engineer,
Albany, N. Y.

Dear Sir:-

On July 16, 1926, Mr. T. S. Bailey of this department made an inspection of the dam being built on Willow Brook, near Monroe. Mr. Bush, the engineer in charge, informed him that work had been resumed early in May and would be completed about November 1, 1926.

The excavation is practically 90% complete for the core wall. A small amount of excavation remains to be done in the core wall foundation near the west side of the valley, where the limestone is being removed down to the gneiss.

The backfill of the foundation trench is about 70% complete. 186 feet of core wall is completed to grade. Excavation for the spillway and waste channel is in progress. The blow-off conduit is being concreted. No embankment has been done. A section of the waste channel, about 30 feet long, below the blow-off conduit, has been lined, as shown on the plans.

Mr. Bailey reports that the dam is being constructed strictly in accordance with the approved plans, and the foundation is excavated in every case to satisfactory material.

Very truly yours,


Division Engineer.

KNIGHT, BUSH & THOMPSON

CIVIL ENGINEERS AND SURVEYORS

TELEPHONE 2272

WILLIAM C. KNIGHT

SEP 24 1925.

MONROE, N.Y.
PERIODIC
ANNUAL

September 26th, 1925.

DAM 450, T. H.
Monroe.

Mr. Roy G. Finch,
State Engineer,
Albany, N. Y.
Dear Sir:-

Repliesing to your letter of the 21st inst., concerning the work done at Willow Brook dam, we have to state that prior to suspension of work in February, 1924, about three hundred feet of excavation for the corewall had been made and about one hundred feet of corewall, varying in height from twelve to twenty feet, had been placed. The depth of excavation in rock, from natural surface to foundation, varied from three to eighteen feet. No concrete was placed until solid rock, free from faults, fissures and seams, was reached.

The rock bottom is partly limestone and partly hard black shale.

When work was suspended the excavation flooded and remained so until about two weeks ago when pumps were put in operation to remove the water.

On the 21st inst., work was resumed and has consisted principally, of removing the debris and material which sloughed in due to the flooding, and the continuation of excavating.

A short section of the bottom is about ready for the corewall and concreting will be resumed some time next week.

As to the various materials encountered in making the excavation, they are clearly shown by the boring sheet furnished your inspector, Mr. Kellog, when he visited the work on July 7th, last.

No cross-sections, to determine quantities, are taken as the work is being done directly by the Orange & Rockland Electric Co., the owner, hence we have no record, other than the boring sheet, of the depths and classifications of the various materials encountered. However, from our observations of the banks, we have found the boring sheet to be quite reliable as to classifications and depths.

We would ask that you kindly extend the time of the permit for construction from November 1st, 1925, the original date, to November 1st, 1926, as it will not be possible, with the plant and equipment being used, to complete the work this season.

Should you require further information concerning the work we will be glad to furnish it; also, we would be pleased to have your inspector visit the work soon.

Very truly yours,

Knights, Bush & Thompson

KNIGHT, BUSH & THOMPSON

CIVIL ENGINEERS AND SURVEYORS

TELEPHONE 22 P.M.

OFFICE CHARGING

A.G.-5 1925

MONROE N.Y.
PERFD to Monroe
ANSD

August 4th, 1925.

Mr. Roy G. Finch,
State Engineer,
Albany, N. Y.

Dear Sir:-

Replying to your letter of July 28th, concerning grubbing at the dam site of the Willow Brook Dam, Dam No. 450, L. Hudson, we wish to report that the excavating is being done with a drag-line excavator and the width of the excavation is much greater than would be the case were it being done by vertical trenching. The tops of the slopes of the excavation fall very near the toe of the proposed embankment, i. e. not much of the embankment will fall outside of the limits of the excavation. However, we assure you, wherever grubbing and removal of top soil are necessary it shall be done.

Concerning the materials encountered in making the excavation, we furnished your inspector, Mr. Kellogg, with a classification sheet showing the various materials and their depths; this sheet, we believe, furnishes the information requested.

Very truly yours,

Knights Bush & Thompson

STATE OF NEW YORK

DEPARTMENT OF

State Engineer and Surveyor
ALBANY

Received Feb 6 - 1924 - June 4 - 1924 Dam No. 450 L Hudson Watershed

Disposition Approved June 4 - 1924 Serial No. 565 FEFU 10 ANG

Site inspected

Foundation inspected

Structure inspected

Application for the Construction or Reconstruction of a Dam

Application is hereby made to the State Engineer, Albany, N. Y., in compliance with the provisions of Chapter LXV of the Consolidated Laws and Chapter 647, Laws of 1911, Section 22 as amended, for the approval of specifications and detailed plans, marked Orange & Rockland Electric Co., Plans for Dam at Monroe, N. Y.

herewith submitted for the construction of a dam located as stated below. All provisions of law will be complied with in the erection of the proposed dam.

1. The dam will be on Willow Brook branch of Moodna Creek in the town of Blooming Grove, County of Orange

and 1 5/8 mile northwesterly from the Village of Monroe

(Give exact distance and direction from a well-known bridge, dam, village, stream crossing or mouth of a stream)

2. The name and address of the owner is Orange & Rockland Electric Co., Monroe, N. Y.

3. The dam will be used for impounding water for cooling steam condensers

4. Will any part of the dam be built upon or its pond floor any State lands? No.

5. The watershed at the proposed dam draining into the pond to be formed thereby is 1.36 square miles.

6. The proposed dam will have a pond area at the spillcrest elevation of seventy-four acres and will impound 25,000,000 cubic feet of water.

7. The lowest part of the natural shore of the pond is twelve (12) feet vertically above the spillcrest at junct. embankment and everywhere else the shore will be at least five feet above the spillcrest and natural shore

8. The maximum known flow of the stream at the dam site was ----- cubic feet per second on ----- (Date)

9. State if any damage to life or to any buildings, roads or other property could be caused by any possible failure of the proposed dam. Damage to roads and bridges, slight damage to few buildings probable; damage to life improbable.

10. The natural material of the bed on which the proposed dam will rest is (clay, sand, gravel, boulders, granite, shale, slate, limestone, etc.) Carewall on Gneiss, Shale and Limestone; embankment on clay and hardpan.

AD-A105 933

BAKER (MICHAEL) JR INC BEAVER PA
NATIONAL DAM SAFETY PROGRAM, WILLOW BROOK DAM (INVENTORY NUMBER--ETC(U)
AUG 81 G KESTER

F/G 13/13

DACW51-81-C-0010

NL

UNCLASSIFIED

2 OF 2
AD A
105933



END
DATE
FILED
11-81
DTIC

clay and

11. The material of the right bank, in the direction with the current, is gravel _____; at the spillcrest elevation this material has a top slope of 3 inches vertical to a foot horizontal on the center line of the dam, a vertical thickness at this elevation of 6 feet, and the top surface extends for a vertical height of 20 feet above the spillcrest.

12. The material of the left bank is hardpan _____; has a top slope of 1 1/2 inches to a foot horizontal, a thickness of 5 feet, and a height of ^{to top of mountain} _____.

13. State the character of the bed and the banks in respect to the hardness, porosity, water bearing, effect of exposure to air and to water, uniformity, etc. The bed of the valley is a layer of soil about 1 ft. deep, a layer of impervious blue clay about 10 ft. deep and a layer of clay, gravel and boulders about 8 ft. deep overlaying the rock which at the left bank is gneiss, middle shale and left bank limestone.

14. If the bed is in layers, are the layers horizontal or inclined? inclined. If inclined what is the direction of the slope relative to the center line of the dam and the inches vertical to a foot horizontal? The limestone at the right bank is inclined about 3°:1' downward upstream.

15. What is the thickness of the layers? FROM TWO TO SIX FEET.

16. Are there any porous seams, or fissures? Yes, in the limestone.

17. WASTES. The spillway of the above proposed dam will be 25 feet long in the clear; the waters will be held at the right end by a corewall and bank the top of which will be 5 feet above the spillcrest, and have a top width of 6 feet; and at the left end by a corewall and bank the top of which will be 5 feet above the spillcrest, and have a top width of 6 feet.

18. There will be also for flood discharge a pipe 24 inches in diameter and the bottom will be 13.17 feet below the spillcrest, a sluice or gate 2 feet wide in the clear by 2 feet high, and the bottom will be 13.17 feet below the spillcrest.

19. APRON. Below the proposed dam there will be an apron ~~base~~ of natural ledge rock feet long, feet wide and feet thick. The downstream side of the apron will have a thickness of feet for a width of feet.

20. PLANS. Each application for a permit of a dam over 12 feet in height must be accompanied by a location map and complete working drawings of the proposed structure. Each drawing should have a title giving the parts shown, the name of the town and county in which the dam site is located, and the name of the owner and of the engineer.

The location map (U. S. Geological Quadrangle or other map) should show the exact location of the proposed dam; of buildings below the dam which might be damaged by any failure of the dam; of roads adjacent to or crossing the stream below the dam, giving the lowest elevation of the roadway above the stream bed and giving the shape, the height and the width of stream openings; and of any embankments or steep slopes that any flood could pass over. Also indicate the character and use made of the ground.

The complete working drawings should give all the dimensions necessary for the calculations of the stability of the structure, and all the information asked for below under "Sketches." There may be attached to the plans any written reports, calculations, investigations or opinions that may aid in showing the data and method used by the designer.

31. SKETCHES. For small and unimportant structures, if plans have not been made, on the back sheet of this application make a sketch to scale for each different cross-section at the highest point; showing the height and the depth from the surface of the foundation, the bottom width, the top width (for a concrete or masonry spill at 18 inches below the crest), the elevation of the top in reference to the spillcrest, the length of the section, and the material of which the section is to be constructed. Mark each section with a capital letter. Also sketch a plan; show the above sections by their top lines, giving the mark and the length of each; the openings by their horizontal dimensions; and the abutments by their top width and top lengths from the upstream face of the spillcrest and give the elevation of the top in reference to the spillcrest.

32. ELEVATIONS. Also give the elevations, if possible from the Mean Sea Level, of at least two permanent Beach Marks; of the spillcrest for any existing dam on the proposed dam site, at the middle and at both ends of the spill; and of the spillcrest for the above proposed dam.

33. SAMPLES. When so instructed, send samples of the materials to be used in the construction of the proposed dam, using shipping tags which will be furnished. For sand one-half a cubic foot is desired; for cement, three pints; and for the natural bed, twenty cubic inches.

34. INSPECTION. State how inspection is to be provided for during construction. Construction to be done under supervision of Knight, Bush & Thompson, Engineers.

Note: The corewall is to be carried down to solid rock foundation and extend into the rock at each end.

43 66
11

MEMORANDUM FOR MR. A. R. McKIM, INSPECTOR OF DOCKS AND DAMS

I have examined the section submitted by Knight, Bush & Thompson for the spillway of the proposed dam to be built by the Orange & Rockland Electric Company at Willow Brook near Monroe, N.Y.

I have figured this section for stability and sliding under the following conditions:

Height of water 4 feet over crest.

No weight figured for water on crest.

Uplift of one quarter the total head at the upstream face of the dam, diminishing to zero at the downstream face.

No back pressure from water below dam.

Masonry 140 pounds per cubic foot.

Under these conditions I find the resultant pressure to be 3.2 feet from the downstream face. This is 0.45 feet inside the middle third. The coefficient of sliding is 0.477 under the same conditions.

H. E. Brainard

Assistant Engineer.

G. H. Wood,
April 24, 1924.

Dam at Monroe, N.Y.
Orange and Rockland Electric Co.

Sheet No 2.

Slab over gate house.

Assume concrete slab to be self supporting

Assume brackets to support load on ch. plates.

Let w = live load + dead load per square ft:

Slab. Span 6', effective $d = 3'$, total $d = 3'$
reinforcements: $\frac{1}{2}''$ bars 5' c/c = 0.60" per. ft.

$$M = \frac{w l^2}{8} = \frac{w \cdot 6 \cdot 6 \times 12}{8} = 54w.$$

$$A_{st} = \frac{M}{f_y c I}, w = \frac{0.60 \times 14000 \times 12}{54} = 466^* \text{ per sq'}$$

assume wt of slab =

Slab is 1 foot 10"

Brackets.

Area of ch. pl supported by each bracket = $2.25 \times 1.5 \pm$ say $3.4''$.

$$3.4 \times 1.5 / (4 \times 0.25 \times 16000) \times 1.5^* \\ w = 4700^* \text{ per sq'}$$


$$\text{Bond stress} = 80^*/sq'.$$

$$3.4 \times 1.5 = 1.5 \times (4 \times 80 \times 12)$$

$$3.4w = 4320^*$$

$$w = 1270^* \text{ per sq' (live and dead)}$$

Benedict, June, 1924.

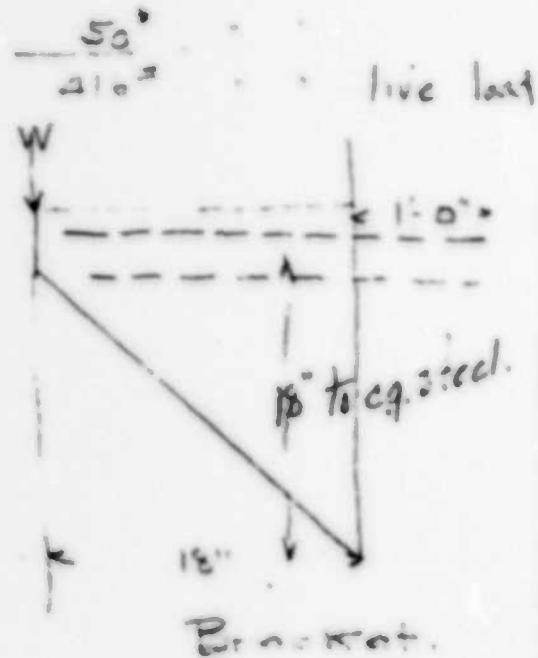

1/1

Dam at Monroe, N.Y.
Orange and Rockland Elec. Co.

Sheet 2. Section of conduit.

Water Surface Max. El. 589
Invert of culvert El. 529.66 say El. 52.9 } Max head = 20'
El. 52.9 }

Intensity of pressure due to 20' head = 1250² per square ft.
total pres. tending to cause rupture of side walls

$$\frac{1+50^2 \times d}{2} = 1:50 \times 2.17 = 360^2 \text{ per lin ft of pipe}$$

Resistance to rupture. 2.5 bars = $2 \times 0.14^2 \times 16000^3 = 4490^2$
Side bars as shown are amply strong.

Culvert empty. Earth pressure El. 590 - El 572 = 18' head = $1575^2/2c$
Assume beam, d. 4 ft, sp. in. = 2

$$\text{Area steel required} = \frac{1860 \times 2 \times 2.17^3}{8 \times 14000 \times 4.5} = \frac{108}{630} = 0.172^2$$

On acct arch action of culvert, bars are O.K.

Benedict June 1924.

KNIGHT, BUSH & THOMPSON

CIVIL ENGINEERS AND SURVEYORS

TELEPHONE 22 P 2

MONROE, N. Y.

April 21st, 1924.

Mr. Arnold G. Chapman,
Deputy State Engineer,
Albany, N. Y.

Dear Sir:-

Dam No. 450 Lower Hudson,
Monroe.

We are sending you herewith a sketch showing a revised section for the waste weir or spillway of the Willow Brook Dam, proposed to be built by the Orange & Rockland Electric Co., near Monroe, N. Y.

This section is designed to meet the requirements set forth in your letters of February 7th and March 4th, 1924; i. e., maximum crest or overflow 4 feet; uplift pressure at upstream edge equal to one-quarter of the maximum head ($4/10$) and diminishing uniformly to zero at the downstream edge; no downthrust due to weight of water on crest of weir; no back pressure on downstream face and weight of masonry assumed to be 140 pounds per cubic foot. The area of the section shown on the accompanying sketch does not include the foundation bond key, nor has any deduction been made for the rounding of the corners of the steps on the downstream side.

Should this section meet with your approval, we would ask that you please return the plans submitted so that we may correct them to agree with this revision.

Very truly yours,


Knights, Bush & Thompson

KNIGHT, BUSH & THOMPSON
CIVIL ENGINEERS AND SURVEYORS

TELEPHONE 33 P. 2

Maximum High Water Level El. 589.0

MONROE, N. Y.

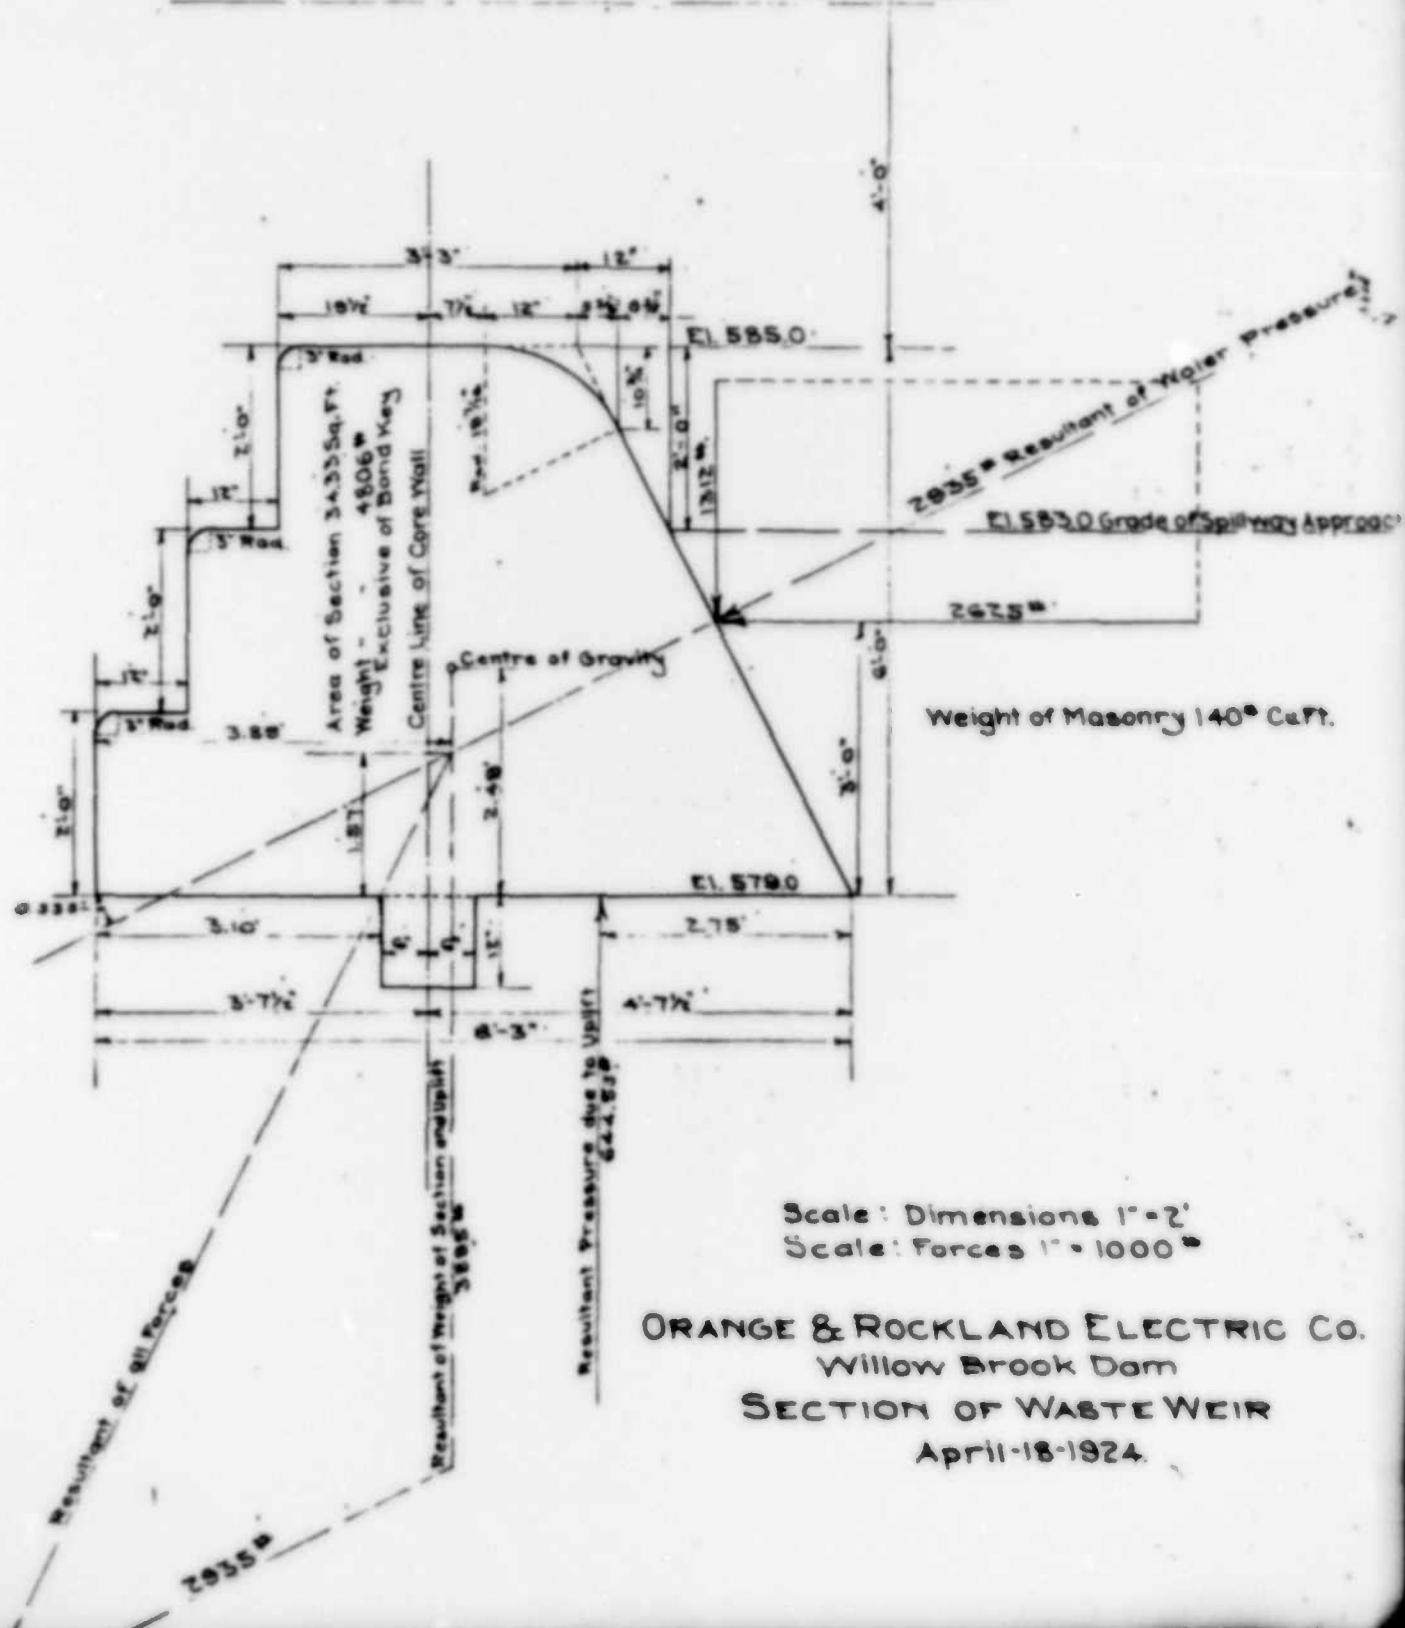

ATE
LMED
-8